



INSPECTION REPORT

Created by	Ian WILLINGHAM	Date Created	22/06/2026 14:44
Form ID	SP138496-SVRF - RT1p-General-0002		

PROJECT INFORMATION

SP Number	SP138496
Project Name	St Marks Church of England Primary School
Project Address	Brantridge Lane, Haywards Heath, West Sussex RH17 6EN
Date	22/06/2026 10:00
Weather	Sunny
Temperature °C	25°C-30°C
Reason for Visit	Inspection
Project Information	Project installed in Summer 2024.

ALUMASC INFORMATION

Alumasc Site Tech	Ian WILLINGHAM
Area Technical Manager	Jonathan TAYLOR
Waterproofing system(s)	Eurorooft SA

INSTALLING CONTRACTOR INFORMATION

Installing Contractor	Richard Soan Roofing Services
Contracts Manager	Steve Dixon

OTHER PERSONNEL PRESENT

Number of other personnel present?	1
Name Of Attendee	Steve Dixon
Company	Richard Soan Roofing Services

CIRCULATION LIST

Circulate to No of people	None
----------------------------------	------

DISCLAIMER

Alumasc site inspections are strictly for warranty purposes, and only capture the site conditions and work in progress at the time of inspection. The responsibility for supervision and correct installation of all layers and associated works in accordance with the specification, relevant standards and Codes of Practice lies solely with the installing contractor, as does compliance with Health and Safety regulations.

ROOFING CHECKLIST	
Number of Roof Areas to inspect	1
Roof Section 1	
Roof Name / Ref:	Flat Roof
Describe Roof Build-up	Ply Deck, SA AVCL, Tapered GTF PIR, SA Underlay, Eurorof SA Capsheet
Site Images	
	
Roof Overview - 22/06/2026 15:41	Roof Overview - 22/06/2026 15:41
	
Roof Overview - 22/06/2026 15:41	Remedials carried out to area of severe Blisters - 22/06/2026 15:41

Site Images



Remedials carried out to area of severe Blisters - 22/06/2026 15:41



Blister still present, not stressing Laps - 22/06/2026 15:41



Blister still present, not stressing Laps - 22/06/2026 15:41



Blister in the area of Remedials - 22/06/2026 15:41

Comments

Remedials have been completed to the area of severe Blistering as recommended following the previous Inspection.

A blister is present in the area of the remedials, its suspected that this was minor at the time of repairs and was missed.

Other minor Blisters are still present. Blisters are still not stressing any Laps.

Agreed with Steve Dixon that the Blister to the area of Remedials is to be star cut and Overlaid, as a Goodwill gesture 2 remaining Blisters as Photos will be star cut and overlaid.

Alumasc would be happy to carry out a further inspection in 6 months to monitor the roof area.