



Wickenden Manor, Sharpthorne

**Arboricultural Impact Assessment and
Method Statement**

Revision P1

July 2026



Client	Netherhall Education Association		
Job name	Wickenden Manor, Sharpthorne		
Report title	Arboricultural Impact Assessment and Method Statement		
File reference	20-1113-Report- P1		
	Name	Position	Date
Author	Neil Taylor	Arboricultural Consultant	July 2026

Report Contents

1	Introduction	1
1.1	Site Description.....	1
1.2	Proposed Works	1
1.3	Aims of Study	1
2	Methodology	2
3	Assessment	3
3.1	Tree Character Groups.....	3
4	Arboricultural Implications Assessment (AIA)	4
4.1	Methodology	4
4.2	Assessment	4
5	Arboricultural Method Statement (AMS)	6
5.1	Methodology	6
5.2	Demolition within the RPA of Retained Trees	6
5.3	Construction within the RPA of Retained Trees.....	6
5.4	Services.....	7
5.5	Tree Protection.....	7
5.6	Site Monitoring and Supervision	7
6	Conclusion.....	9
7	Appendices	10

1 Introduction

1.1 Site Description

Wickenden Manor, Sharpthorne (the “site”) is situated approximately a mile southeast of the centre of Sharpthorne. The site currently comprises a large manor house used as a conference centre, a separate lodge used for delegates accommodation and disused stables, all set within an established landscape.

1.2 Proposed Works

The construction of an extension to the manor house, the addition of a conservatory to the lodge, the extension and conversion of the stables to delegate’s accommodation, the installation of a solar array and the installation of a two new access drives and two new footpaths are proposed. Works that are likely to affect retained trees include the construction of new hard surfaces and the movement of construction machinery.

1.3 Aims of Study

To inform a planning application, Canopy Consultancy has been commissioned by Netherhall Education Association to undertake a tree survey of the site, in accordance with British Standard (BS) 5837:2012 “Trees in Relation to Design, Demolition and Construction - Recommendations”.

The aim of this report is to present the results of the survey, including a Tree Survey Schedule (TSS), an Arboricultural Implications Assessment (AIA), and an Arboricultural Method Statement (AMS). A Tree Protection Plan (TPP) has also been produced and accompanies this report as a separate drawing.

This report in no way constitutes a health and safety survey report. Where concerns for tree health and safety exist, the necessary and appropriate tree inspections should be carried out.

2 Methodology

The trees were inspected from ground level by consultant arboriculturist Neil Taylor on 23rd September 2020 and Oliver Halladay on 3rd March 2026. Measurements were taken in accordance with the recommendations set out in the BS 5837:2012. Canopy spreads were measured and plotted to the four compass points. Where direct access was not possible measurements have been estimated. The surveyed trees are colour coded on the accompanying tree survey drawing according to their relevant BS category.

The tree data collected is used to enable the current canopy spread of the surveyed trees and the Root Protection Area (RPA) to be plotted on the accompanying TPP. The RPA is defined by the formula in paragraph 4.6 from the BS 5837:2012 and may be refined by taking into account current on-site constraints to root activity such as buildings, earthworks and hard paving. This forms part of the design process for the proposed development.

3 Assessment

3.1 Tree Character Groups

The detailed results of the tree survey are provided in the TSS, in Appendix 1. In summary, the trees on the site are in a reasonable condition and vary in terms of amenity value provided to the wider landscape. The trees can be divided into three distinct character groups as follows:

1. The first character group includes the large mature trees found growing across the site. The majority of the trees in this character group are in a good condition and are an integral part of the historic landscape.
2. The second character group includes the medium sized, middle-aged trees found growing across the site. In the main, the trees in this character group are in a reasonable condition and bring a sense of maturity to the site.
3. The third character group includes the smaller, young trees found growing across the site. The trees in this character group are in a good condition but due to their size are of limited amenity value to the local area.

4 Arboricultural Implications Assessment (AIA)

4.1 Methodology

The AIA uses the information obtained in the tree survey to identify areas where the proposed construction may be at odds with accepted standards, in terms of a tree's requirements for space in which to maintain existing roots and shoots, and space for future growth.

The quality and relative importance of each tree is illustrated as a coloured polygon. The colour used relates to the BS categories as follows: A - green, B - blue, C - grey and R - red (see accompanying drawing reference 20-1113-TPP-B). In general, the design process will try to retain A and B category trees. Proposed construction will therefore normally be excluded from the RPA of A and B category trees. Red trees are discounted as they are recommended for removal.

Details of the trees surveyed are given in the TSS (Appendix 1). The juxtaposition of the proposed development in relation to existing tree locations are shown on the accompanying TPP drawing, reference 20-1113-TPP-B.

The AIA considers existing site conditions and the effect that they may have on the development of the surveyed trees' root systems. Hard structures such as building and paved roads and paths can influence the root activity of trees by reducing the availability of both moisture and nutrients.

4.2 Assessment

Refer to the accompanying TPP, drawing, reference 20-1113-TPP-B, for the relationship between the proposed development and the trees on and adjacent to the site.

- The following tree will be removed for arboricultural reasons:

T30

- The following trees will be removed to enable the proposed development:

T7	to enable the construction of a driveway
T17	to enable the construction of an extension to the manor house
T18	to enable the construction of an extension to the manor house
T32	to enable the construction of an extension to the stables
T33	to enable the construction of an extension to the stables
G1	to enable the construction of an extension to the manor house
Part of G2	to enable the construction of an extension to the manor house
Part of G3	to enable the construction of a driveway

G7 to enable the construction of an extension to the stables

- There will be no demolition within the RPA of a retained tree.
- The following trees will be affected by the construction of new footpaths and access drives within the RPA:

T2, T3, T15, T16, T20, T31, T97, T98, T119, T115, T116, T117 and W1

The proposed hard surfaces will be porous and will be constructed in accordance with the 'no dig' principles outlined in APN12 and utilise a cellular confinement system such as Cell Web as a subbase. Refer to Section 5.3 below for details.

- The following tree will be affected by excavations to lower the level on the edge of the RPA:

T19

The percentage incursion into the RPA is 1% and is therefore considered acceptable. As a precaution, excavations will be carried out in accordance with the methodology outlined in Section 5.3 below.

5 Arboricultural Method Statement (AMS)

5.1 Methodology

The AMS provides the means by which retained trees and hedges can be protected throughout the development.

The movement of demolition and construction machinery in close proximity to trees may cause compaction of the soil which affects the tree's ability to absorb moisture and nutrients. The RPAs of retained trees and hedges will be protected by a tree protection barrier as described in paragraph 5.5 below and shown on the accompanying TPP, drawing number 20-1113-TPP-B.

5.2 Demolition within the RPA of Retained Trees

There will be no demolition within the RPA of a retained tree.

5.3 Construction within the RPA of Retained Trees

Prior to construction commencing, the retained trees will be protected in accordance with the accompanying TPP, drawing number 20-1113-TPP-B.

Excavations Within the RPA

Where excavations are required on the edge of the RPA of T19, they will be carried out by hand under the supervision of a suitably qualified arboriculturist for the top 600mm. Any roots encountered will be pruned back to the edge of the trench using sharp secateurs.

Construction of Hard Surfaces

Construction of the new footpaths and access drives that within the RPA of a retained tree will utilise a cellular confinement system such as Cell Web in order to minimise the excavations required. The new hard surface will be constructed on top of the existing ground level, and no excavations will take place to level the ground. Guidance on the form of construction necessary to avoid root damage and loss is provided in the form of an extract of the Cell Web Product brochure for their cellular confinement system at Appendix 2. The installation of the hard surface should proceed in the following order:

- Lay geotextile membrane over the soil and pin into place
- Lay cellular confinement system (such as Cell Web) as specified by engineer and pin into place.

- Fill the cellular confinement system with a 'no fines' aggregate to engineer's specification. Work must be carried out progressively so that any machinery used only moves on the laid surface.
- Install timber edging (if required) as specified by engineer
- Lay geotextile membrane over filled cellular confinement system.
- Lay wearing course as specified by landscape architect

Where the proposed new hard surface is to be installed on the existing soft landscape, allowances will be made for the increase in level which can be graded out across the remainder of the new and existing hard surface.

No materials or spoil is to be stored within the RPA of a retained tree.

In order to avoid damage to the retained trees the tree surgery and felling work identified in the accompanying tree survey schedule will be carried out prior to the occupation of the site by the building contractor. The work will be carried out in accordance with BS 3998:2010.

5.4 Services

The proposed locations of service runs have not been finalised at this early stage but should be located so as to not pass through the RPAs of retained trees on an adjacent to the site. Where this is not possible excavations will be carried by hand in accordance with 'broken trenches' described in NJUG 4 Section 4, an extract of which can be found in Appendix 3. This will ensure that tree roots are not damaged during the installation of the service. All root pruning will be agreed beforehand with the named arboriculturist in consultation with the local authority arboricultural officer. All root pruning will be in accordance with current best working practice.

5.5 Tree Protection

All trees that are to be retained on the site will be protected by the use of a tree protection barrier erected in the location shown on the accompanying TPP, drawing number 20-1113-TPP-B. The fence will consist of "Heras" type panels or similar braced at appropriate intervals and secured to keep in place. The tree protection barrier will be erected prior to the occupation of the site by the building contractor and will only be removed once the construction phase is complete.

5.6 Site Monitoring and Supervision

The process of reporting to the client and LPA/Tree Officer will be by emailing the checklist form at Appendix 4. Site monitoring is to be at a frequency agreed and approved by the LPA. It will

involve a site visit by the arboriculturist at selected intervals to ensure that the appropriate tree protection measures, as detailed in the approved drawings and method statements, are continually adhered to

6 Conclusion

Canopy Consultancy was commissioned by Netherhall Education Association to carry out a tree survey at the site. The results of the survey indicate that the trees within the survey area vary considerably in terms of condition and contribution to the amenity of the wider landscape.

A total of five individual trees, two groups of trees and part of two further groups of trees will be removed to enable the proposed development. The majority of the trees to be removed are within the 'C' category and will have little impact on the amenity of the local area.

The proposed development of the site provides an opportunity to plant a number of new trees as part of a landscape scheme for the site. This will improve the age range and species diversity of the trees in the local area, as well as enhancing the tree cover on the site.

Through the specified tree protection measures and construction methodology, it will be possible to minimise the impact of the proposed development on the retained trees.

Overall, there are no known overriding arboricultural constraints which would prevent the proposed development from going ahead, subject to the protection measures and construction methodologies specified within this report being correctly implemented.

7 Appendices

Appendix 1: Tree Survey Schedule

Project:	Wickenden Manor, East Grinstead							BS 5837 2012 Trees in relation to design, demolition and construction- recommendations	Surveyed by		NAT and OH				
Ref:	20-1113-TSS								Weather		Overcast				
Date:	23.09.20 and 03.03.26								Tagged		No				
Client:	Netherhall Education Association														
				Canopy Spread											
Tree No.	Species	Height (m)	DBH (mm)	N	E	S	W	Stems	Height of crown clearance	Age class	Physiological condition problems/comments	Structural condition	Preliminary management recommendations	Estimated remaining contribution years	BS category
T4	beech (Fagus sylvatica)	6	340	4	1	3	6	1	1	MA	Fair - early leaf loss	Fair - historic root failure	None	10-20	C1
T5	ash (Fraxinus excelsior)	8	313	3	2	2	3	3	3	MA	Poor - severe die back	Fair	Remove	0-10	U
T12	cherry (Prunus sp.)	6	170	2	4	3	1	1	1.5	Y	Good	Fair - poor form	None	10-20	C1
T13	western red cedar (Thuja plicata)	6	180	1	3	1	2	1	1	Y	Fair - die back	Good	Remove	0-10	U
T17	goat willow (Salix caprea)	7	404	4	4	3	3	5	2	MA	Good	Fair - multi stem	None	10-20	C1
T18	scots pine (Pinus sylvestris)	16	540	3	4	3	4	1	7	M	Good	Good	None	20-40	B2
T30	ash (Fraxinus excelsior)	6	200	3	3	3	3	1	1.5	Y	Poor - die back	Good	None	0-10	U
T31	oak (Quercus robur)	15	730	6	6	6	6	1	2	M	Good	Good	None	40+	A2
T32	oak (Quercus robur)	5	220	5	7	3	2	1	2	Y	Good	Fair - poor form	None	20-40	C1
T33	oak (Quercus robur)	8	390	5	5	6	4	1	2	MA	Good	Good	None	40+	B2
T34	Acer sp. (Maple)	3.5	122	1.5	1	1	1	2	2	Y	Poor - Declining.	Fair	None	10-20	C1
T35	Quercus robur (Common Oak)	10	610	6	5	6	6	1	2	MA	Good	Good	None	40+	B1
T36	Ilex aquifolium (Holly)	10	323	3	1	2	1	5	2	MA	Fair - Low vitality.	Good	None	20-40	C1

Project:	Wickenden Manor, East Grinstead							BS 5837 2012 Trees in relation to design, demolition and construction- recommendations	Surveyed by		NAT and OH				
Ref:	20-1113-TSS								Weather		Overcast				
Date:	23.09.20 and 03.03.26								Tagged		No				
Client:	Netherhall Education Association														
				Canopy Spread											
Tree No.	Species	Height (m)	DBH (mm)	N	E	S	W	Stems	Height of crown clearance	Age class	Physiological condition problems/comments	Structural condition	Preliminary management recommendations	Estimated remaining contribution years	BS category
T37	Prunus avium (Wild Cherry)	5.5	410	1.5	2	2	2	1	2	MA	Fair - Low vitality. Previously reduced.	Fair - Decay present on stem.	None	10-20	C1
T38	Acer pseudoplatanus (Sycamore)	9	446	3	5	4	5	5	2	MA	Fair - Poor shape & form.	Fair - Multiple stems below 1.5m. Included bark present in fork.	None	20-40	C1
T39	Crataegus monogyna (Hawthorn)	7	373	2	2	2	2	8	2	MA	Good - Multiple stems at ground level.	Good	None	40+	B2
T40	Quercus rubra (Red Oak)	16	830	5	6	9	7	1	2	MA	Good	Poor - Vertical split in stem from 1.2m to 4m tension side, stem failure highly likely.	Remove tree.	<10	U
T41	Sorbus aucuparia (Rowan)	7	200	1.5	2	2	2	1	4	MA	Fair - Ivy on tree. Unable to inspect entire stem due to Ivy.	Fair - Decay present on stem.	None	20-40	C1
T42	Crataegus monogyna (Hawthorn)	6	200	1.5	1	2	2	1	3	MA	Fair - Low vitality. Ivy on tree. Unable to inspect stem due to Ivy.	Fair	None	10-20	C1
T43	Acer pseudoplatanus (Sycamore)	6.5	164	1.5	2	2	2	2	5	MA	Fair - Low vitality.	Fair - Stem divides below 1.5m. Major deadwood in crown.	None	20-40	C1
T44	Crataegus monogyna (Hawthorn)	6	239	1.5	2	2	2	2	3	MA	Fair - suppressed. Ivy on tree.	Fair - Stem divides below 1.5m.	None	20-40	C1
T45	Acer pseudoplatanus (Sycamore)	8.5	210	1	2	2	1	1	3	MA	Fair - Low vitality. suppressed.	Fair - Major deadwood in crown.	None	20-40	C1

Project:	Wickenden Manor, East Grinstead							BS 5837 2012 Trees in relation to design, demolition and construction- recommendations	Surveyed by		NAT and OH				
Ref:	20-1113-TSS								Weather		Overcast				
Date:	23.09.20 and 03.03.26								Tagged		No				
Client:	Netherhall Education Association														
				Canopy Spread											
Tree No.	Species	Height (m)	DBH (mm)	N	E	S	W	Stems	Height of crown clearance	Age class	Physiological condition problems/comments	Structural condition	Preliminary management recommendations	Estimated remaining contribution years	BS category
T46	Fraxinus excelsior (Ash)	10.5	270	3.5	5	5	2	1	5	MA	Good	Good	None	40+	B2
T47	Fraxinus excelsior (Ash)	12	400	1	1	2	8	1	3	MA	Poor - Poor shape & form. Declining. Dieback in crown.	Fair	None	<10	U
T48	Acer pseudoplatanus (Sycamore)	15	751	4	4	4	6	5	3	MA	Fair - Low vitality. suppressed.	Fair - Multiple stems at ground level. Included bark present in fork. Major deadwood in crown.	None	20-40	C1
T49	Acer pseudoplatanus (Sycamore)	9	277	3	1	2	3	2	3	MA	Fair - Poor shape & form. suppressed.	Fair	None	20-40	C1
T50	Acer pseudoplatanus (Sycamore)	3	150	0.5	1	1	1	1	3	Y	Poor - Moribund.	Poor	None	<10	U
T51	Acer pseudoplatanus (Sycamore)	8	180	7	3	1	1	2	3	MA	Poor - Poor shape & form. Declining. suppressed. Major deadwood in crown. Unbalanced crown shape.	Poor	None	10-20	C1
T52	Acer pseudoplatanus (Sycamore)	10	353	5	4	2	4	2	2	MA	Fair - Poor shape & form. suppressed.	Good	None	20-40	C1
T53	Quercus robur (Common Oak)	14	650	6	4	6	6	1	2	MA	Good	Good	None	40+	B1

Project:	Wickenden Manor, East Grinstead							BS 5837 2012 Trees in relation to design, demolition and construction- recommendations	Surveyed by		NAT and OH				
Ref:	20-1113-TSS								Weather		Overcast				
Date:	23.09.20 and 03.03.26								Tagged		No				
Client:	Netherhall Education Association														
				Canopy Spread											
Tree No.	Species	Height (m)	DBH (mm)	N	E	S	W	Stems	Height of crown clearance	Age class	Physiological condition problems/comments	Structural condition	Preliminary management recommendations	Estimated remaining contribution years	BS category
T54	Prunus avium (Wild Cherry)	5	360	1.5	2	2	2	1	2	MA	Poor - Low vitality. Previously reduced..	Poor - Decay present on stem	None	<10	U
T55	Quercus robur (Common Oak)	13	410	4.5	5	4	6	1	3.5	MA	Good - Major deadwood in crown.	Good	None	40+	B2
T56	Acer pseudoplatanus (Sycamore)	7	250	2.5	3	4	2	1	2.5	MA	Fair - Poor shape & form. suppressed.	Good	None	20-40	C1
T57	Acer pseudoplatanus (Sycamore)	8.5	250	1.5	2	4	3	1	5	MA	Fair - Poor shape & form. suppressed.	Good	None	20-40	C1
T58	Acer pseudoplatanus (Sycamore)	8.5	328	2	3	4	5	2	2	MA	Fair - Poor shape & form. suppressed.	Good	None	20-40	C1
T59	Pinus sylvestris (Scots Pine)	13	870	5	6	5	7	1	8	MA	Good	Good - Areas of swelling on stem, tap test indicates stem intact.	None	40+	B1
T60	Pinus sylvestris (Scots Pine)	13	550	4	4	3	6	1	9	MA	Good - Strip of exposed sapwood from 3-7m SE.	Good	None	40+	B2
T61	Cedrus deodora (Deodar)	16	550	5	5	5	4	1	1.5	MA	Good	Good	None	40+	A2
T62	Quercus robur (Common Oak)	14	520	5	5	6	6	1	5	MA	Good - Major deadwood in crown.	Good	None	40+	B2

Project:	Wickenden Manor, East Grinstead							BS 5837 2012 Trees in relation to design, demolition and construction- recommendations	Surveyed by		NAT and OH				
Ref:	20-1113-TSS								Weather		Overcast				
Date:	23.09.20 and 03.03.26								Tagged		No				
Client:	Netherhall Education Association														
				Canopy Spread											
Tree No.	Species	Height (m)	DBH (mm)	N	E	S	W	Stems	Height of crown clearance	Age class	Physiological condition problems/comments	Structural condition	Preliminary management recommendations	Estimated remaining contribution years	BS category
T63	Quercus robur (Common Oak)	9	330	4	5	4	4	1	3	MA	Fair - Poor shape & form. suppressed. Major deadwood in crown.	Good	None	40+	C1
T64	Quercus robur (Common Oak)	11	455	5	5	5	5	2	3.5	MA	Good - Stem divides below 1.5m. Major deadwood in crown.	Good	None	40+	B2
T65	Corylus avellana (Hazel)	5.5	500	2	5	4	1	1	0	M	Good - Coppice.	Good	None	40+	C1
T66	Corylus avellana (Hazel)	6.5	600	4.5	2	5	2	1	0	M	Good - Coppice.	Good	None	40+	C1
T67	Corylus avellana (Hazel)	5	400	3	1	4	1	1	0	MA	Fair - Coppice.	Good	None	40+	C1
T68	Acer pseudoplatanus (Sycamore)	8	210	4	2	4	1	1	3	MA	Fair - Poor shape & form. suppressed.	Good	None	20-40	C1
T69	Acer pseudoplatanus (Sycamore)	9	350	4.5	3	4	2	1	3	MA	Poor - Poor shape & form. suppressed.	Fair - Broken branches in crown. Major deadwood in crown. Squirrel damage in crown.	None	10-20	C1
T70	Quercus rubra (Red Oak)	23	910	5	8	13	9	1	2	M	Good	Good	None	40+	A2
T71	Quercus rubra (Red Oak)	17	600	6	5	6	8	1	2	MA	Good	Good	None	40+	B1

Project:	Wickenden Manor, East Grinstead							BS 5837 2012 Trees in relation to design, demolition and construction- recommendations	Surveyed by		NAT and OH				
Ref:	20-1113-TSS								Weather		Overcast				
Date:	23.09.20 and 03.03.26								Tagged		No				
Client:	Netherhall Education Association														
				Canopy Spread											
Tree No.	Species	Height (m)	DBH (mm)	N	E	S	W	Stems	Height of crown clearance	Age class	Physiological condition problems/comments	Structural condition	Preliminary management recommendations	Estimated remaining contribution years	BS category
T72	Quercus rubra (Red Oak)	2	550	0	0	0	0	1	0	MA	Dead - Monolith.	Good	None	0	U
T73	Betula pendula (Silver Birch)	11	310	3	3	3	3	1	4	MA	Fair - Poor shape & form.	Fair - Decay present on stem. Major bark wounding on stem.	None	10-20	C1
T74	Betula pendula (Silver Birch)	11	282	1	1	4	2	2	3	MA	Fair - Poor shape & form.	Fair - Decay present on stem. Major bark wounding on stem.	None	10-20	C1
T75	Acer pseudoplatanus (Sycamore)	8.5	250	2.5	3	3	3	1	3	MA	Fair - Low vitality. suppressed.	Fair - Major deadwood in crown.	None	20-40	C1
T76	Quercus robur (Common Oak)y	13	500	2	5	7	3	1	5	MA	Fair - Declining. Die back.	Good	None	20-40	C1
T77	Amelanchier lamarckii (Snowy Mespil)	3	190	1	5	2	1	3	1	MA	Good	Fair - Leaning East.	None	20-40	C1
T78	Acer palmatum (Japanese Maple)	3.5	245	1.5	2	2	3	4	1	MA	Fair - suppressed. Major deadwood in crown.	Good	None	20-40	C1
T79	Quercus robur (Common Oak)y	12	450	4	4	5	4	1	5	MA	Good	Good	None	20-40	B2
T80	Amelanchier lamarckii (Snowy Mespil)	5	460	6.5	6	2	5	1	1	M	Good	Good	None	40+	B1
T81	Amelanchier lamarckii (Snowy Mespil)	6	550	3	5	7	5	1	1	M	Good	Good	None	40+	B1

Project:	Wickenden Manor, East Grinstead							BS 5837 2012 Trees in relation to design, demolition and construction- recommendations	Surveyed by		NAT and OH				
Ref:	20-1113-TSS								Weather		Overcast				
Date:	23.09.20 and 03.03.26								Tagged		No				
Client:	Netherhall Education Association														
				Canopy Spread											
Tree No.	Species	Height (m)	DBH (mm)	N	E	S	W	Stems	Height of crown clearance	Age class	Physiological condition problems/comments	Structural condition	Preliminary management recommendations	Estimated remaining contribution years	BS category
T82	Syringia vulgaris (Lilac)	3.5	150	1	2	1	1	3	0	MA	Good	Good	None	10-20	C1
T83	Acer palmatum (Japanese Maple)	5	300	3	3	3	2	1	2	MA	Good	Fair - Stems removed at crown break.	None	10-20	C1
T84	Cotoneaster frigidus (Cotoneaster)	5	381	3	4	3	3	6	1.5	M	Good	Good	None	40+	C1
T85	Syringia vulgaris (Lilac)	2.5	70	1	1	1	1	1	1	Y	Good	Good	None	10-20	C1
T86	Prunus avium (Wild Cherry)	3.5	121	1.5	2	2	2	3	2	Y	Good	Good	None	40+	C1
T87	Malus (Apple)	3	212	2	2	2	2	2	1.5	MA	Good	Good	None	40+	C1
T88	Malus (Apple)	3	162	2	2	2	2	3	1.5	MA	Good	Good	None	40+	C1
T89	Malus (Apple)	3	205	2	2	2	2	2	1.5	MA	Good	Good	None	40+	C1
T90	Malus (Apple)	3	262	2	2	2	2	4	1.5	MA	Good	Good	None	40+	C1
T91	Malus (Apple)	3	191	2.5	2	2	2	3	1.5	MA	Good	Good	None	40+	C1
T92	Malus (Apple)	3	189	1.5	2	2	2	2	1.5	MA	Good	Good	None	40+	C1
T93	Malus (Apple)	4	377	3	3	3	3	4	1.5	M	Good	Poor - Decay present on stem. Cavity on stem.	None	20-40	C1

Project:	Wickenden Manor, East Grinstead							BS 5837 2012 Trees in relation to design, demolition and construction- recommendations	Surveyed by		NAT and OH				
Ref:	20-1113-TSS								Weather		Overcast				
Date:	23.09.20 and 03.03.26								Tagged		No				
Client:	Netherhall Education Association														
				Canopy Spread											
Tree No.	Species	Height (m)	DBH (mm)	N	E	S	W	Stems	Height of crown clearance	Age class	Physiological condition problems/comments	Structural condition	Preliminary management recommendations	Estimated remaining contribution years	BS category
T94	Taxus baccata (Yew)	5	480	4	6	4	2	1	2	MA	Poor - Low vitality. Declining.	Fair	None	20-40	C1
T95	Taxus baccata (Yew)	9	480	4	6	5	3	1	2	MA	Poor - Low vitality. Declining.	Fair	None	20-40	C1
T96	Pinus radiata (Monterey Pine)	16	850	7	7	7	8	1	5	MA	Good	Good	None	40+	A2
T97	Pseudotsuga menziesii (Douglas Fir)	30	960	9	7	6	7	1	6	M	Good	Good	None	40+	A1
T98	Quercus robur (Common Oak)	13	500	6.5	5	7	3	1	3	MA	Good - Broken branches in crown.	Good	None	40+	B3
T99	Quercus robur (Common Oak)	10	420	6.5	2	5	4	1	3	MA	Fair - Poor shape & form. Low vitality. . Unbalanced crown shape.	Fair - Decay present on stem. Major bark wounding on stem. Major deadwood in crown	None	20-40	C1
T100	Quercus ilex (Holm Oak)	12	750	8	7	6	5	1	2	MA	Good	Fair - Poor unions throughout crown.	None	40+	B2
T101	Castanea sativa (Sweet Chestnut)	12	532	7	3	1	6	2	5	MA	Fair - Unbalanced crown shape. Crown distorted due to group pressure.Neighbouring tree to south recently removed.	Poor - Stem divides below 1.5m. Included bark present in fork.	None	10-20	C1
T102	Fagus sylvatica (Beech)	9	500	1.5	5	7	6	1	1.5	MA	Fair - Poor shape & form. Squirrel damage in crown.	Good	None	20-40	C1

Project:	Wickenden Manor, East Grinstead							BS 5837 2012 Trees in relation to design, demolition and construction- recommendations	Surveyed by		NAT and OH				
Ref:	20-1113-TSS								Weather		Overcast				
Date:	23.09.20 and 03.03.26								Tagged		No				
Client:	Netherhall Education Association														
				Canopy Spread											
Tree No.	Species	Height (m)	DBH (mm)	N	E	S	W	Stems	Height of crown clearance	Age class	Physiological condition problems/comments	Structural condition	Preliminary management recommendations	Estimated remaining contribution years	BS category
T103	Chamaecyparis lawsoniana (Lawson Cypress)	11	594	3	3	3	3	3	3	MA	Fair - Low vitality. Multiple stems at ground level.	Good	None	20-40	C1
T104	Chamaecyparis lawsoniana (Lawson Cypress)	6	283	1.5	2	2	2	3	2	MA	Fair - Poor shape & form. Low vitality. suppressed. Multiple stems at ground level.	Good	None	10-20	C1
T105	Quercus robur (Common Oak)	10	380	5	5	6	4	1	2	MA	Good - Wisteria in crown.	Good	None	40+	B2
T106	Quercus robur (Common Oak)	10	350	5	5	6	5	1	2.5	MA	Good	Good	None	40+	B2
T107	Chamaecyparis lawsoniana (Lawson Cypress)	7	403	2	2	2	2	2	1.5	MA	Good	Good	None	40+	B2
T108	Fraxinus excelsior (Ash)	10	300	3	3	3	3	1	4	MA	Poor - Dieback in crown.	Poor	None	<10	U
T109	Fraxinus excelsior (Ash)	7	250	1.5	2	2	2	1	3	MA	Poor - Dieback in crown.	Poor	None	<10	U
T110	Quercus robur (Common Oak)	14	1000	10	10	9	10	1	6	M	Poor - Declining. Dieback in crown. Major deadwood in crown.	Poor - Decay present on stem.	None	<10	C1
T111	Cercidiphyllum japonicum (Katsura tree)	9	418	4	4	4	5	4	3	MA	Good	Good	None	40+	B1
T112	Betula pendula (Silver Birch)	10	250	4	4	4	4	1	3	MA	Good	Good	None	40+	B2

Project:	Wickenden Manor, East Grinstead							BS 5837 2012 Trees in relation to design, demolition and construction- recommendations	Surveyed by		NAT and OH				
Ref:	20-1113-TSS								Weather		Overcast				
Date:	23.09.20 and 03.03.26								Tagged		No				
Client:	Netherhall Education Association														
				Canopy Spread											
Tree No.	Species	Height (m)	DBH (mm)	N	E	S	W	Stems	Height of crown clearance	Age class	Physiological condition problems/comments	Structural condition	Preliminary management recommendations	Estimated remaining contribution years	BS category
T113	Sorbus intermedia (Swedish Whitebeam)	10	250	3	3	3	3	1	3	MA	Good	Good	None	40+	B2
T114	Betula pendula (Silver Birch)	9	224	1.5	2	2	2	2	4	MA	Fair - suppressed.	Good	None	20-40	C1
T115	Paulownia tomentosa (Foxglove tree)	9	400	6	1	1	6	1	2	MA	Fair - Poor shape & form.	Fair	None	20-40	C1
T116	Osmanthus fragrans (Sweet Olive)	5	391	4	1	1	6	3	1	M	Fair - Unbalanced crown shape.	Poor - Multiple stems at ground level. Decay at base. Broken branches in crown.	None	10-20	C1
T117	Quercus robur (Common Oak)	15	530	4	2	5	7	1	6	MA	Poor - Declining. Dieback in crown.	Fair - Broken branches in crown. Major deadwood in crown.	None	10-20	C1
T118	Prunus laurocerasus (Cherry Laurel)	4	162	2	2	2	2	4	1	MA	Good	Good	None	20-40	C1
T119	Fraxinus excelsior (Ash)	12	510	5	3	5	8	2	5	MA	Fair - Poor shape & form. Dieback in crown.	Fair	None	10-20	C1
G1	yew, cherry, ash, hazel	Up to 6	Varied						Y	Good - linear group		Good	None	40+	C1
G2	rhododendron, ash, goat willow, silver birch	Up to 10	Varied						Y-MA	Good - understorey group of young trees and shrubs		Good	None	40+	C1

Project:	Wickenden Manor, East Grinstead							BS 5837 2012 Trees in relation to design, demolition and construction- recommendations			Surveyed by		NAT and OH				
Ref:	20-1113-TSS										Weather		Overcast				
Date:	23.09.20 and 03.03.26										Tagged		No				
Client:	Netherhall Education Association																
				Canopy Spread													
Tree No.	Species	Height (m)	DBH (mm)	N	E	S	W	Stems	Height of crown clearance	Age class	Physiological condition problems/comments	Structural condition	Preliminary management recommendations	Estimated remaining contribution years	BS category		
G3	hazel, ash, rhododendron, yew	Up to 14	Varied								Y-MA	Good - understorey group of young trees and shrubs	Good	None	40+	C1	
G4	common lime	Up to 16	Varied								M	Good - linear group	Good	None	40+	B2	
G5	Norway maple, ash, beech, silver birch, cherry, goat willow, yew, sycamore, common lime	Up to 12	Varied								MA	Good - woodland group	Good	None	40+	B2	
G6	rhododendron, privet	Up to 5	Varied								MA	Good - group of shrubs surrounding grass court	Good	None	20-40	C1	
G7	oak, ash, elder	Up to 5	Varied								Y	Fair - self sown scrub	Good	None	40+	C1	
G8	common lime	Up to 12	Varied								MA	Good - linear group	Good	None	40+	B2	
G9	cherry	Up to 8	Varied								MA	Good - fruit tree group	Good	None	20-40	C1	
G10	cherry plum, blackthorn	Up to 7	Varied								MA	Good - self sown group of scrub	Good	None	20-40	C1	
G11	apple	Up to 4	Varied								Y	Good - fruit tree group	Good	None	20-40	C1	

Project:	Wickenden Manor, East Grinstead							BS 5837 2012 Trees in relation to design, demolition and construction- recommendations			Surveyed by	NAT and OH				
Ref:	20-1113-TSS										Weather	Overcast				
Date:	23.09.20 and 03.03.26										Tagged	No				
Client:	Netherhall Education Association															
				Canopy Spread												
Tree No.	Species	Height (m)	DBH (mm)	N	E	S	W	Stems	Height of crown clearance	Age class	Physiological condition problems/comments	Structural condition	Preliminary management recommendations	Estimated remaining contribution years	BS category	
G12	Acer pseudoplatanus (Sycamore),Betula pendula (Silver Birch),Corylus avellana (Hazel),Ilex aquifolium (Holly),Taxus baccata (Yew),Salix caprea (Goat Willow),Crataegus monogyna (Hawthorn)	Up to 3.5	Varied								MA	Poor - Group of approximately 22 trees and shrubs topped at 3.5m.	Fair	None	10-20	C1
W1	oak, sycamore, silver birch, scots pine, beech, holly	Up to 18	Varied								Y-M	Good - woodland of planted young trees, clearings and mature trees	Good	None	40+	A3
H1	holly	Up to 3	Varied								MA	Good - internal hedge	Good	None	40+	C1
H2	beech	Up to 2	Varied								MA	Good - internal hedge	Good	None	40+	C1
H3	Ilex aquifolium (Holly),Fagus sylvatica (Beech)	Up to 3	Varied								MA	Good - garden hedge.	Good	None	40+	C1
H4	Ilex aquifolium (Holly)	Up to 3	Varied								MA	Good - garden hedge.	Good	None	40+	C1

Project:	Wickenden Manor, East Grinstead							BS 5837 2012 Trees in relation to design, demolition and construction- recommendations			Surveyed by	NAT and OH				
Ref:	20-1113-TSS										Weather	Overcast				
Date:	23.09.20 and 03.03.26										Tagged	No				
Client:	Netherhall Education Association															
				Canopy Spread												
Tree No.	Species	Height (m)	DBH (mm)	N	E	S	W	Stems	Height of crown clearance	Age class	Physiological condition problems/comments	Structural condition	Preliminary management recommendations	Estimated remaining contribution years	BS category	
H5	Ilex aquifolium (Holly),Fagus sylvatica (Beech)	Up to 3	Varied								MA	Good - garden hedge.	Good	None	40+	C1

Appendix 2: Extract from the Cell Web product brochure

CellWeb

Tree Root Protection System



CellWeb Tree Root Protection System provides a flexible and permeable solution for protecting tree roots while creating a strong stable surface for traffic.

With increased urbanisation and more redevelopments of existing properties, the need to be mindful of the impact on the surrounding environment is more important than ever.

The demand for building site access, driveways and parking around existing trees can have a potentially fatal impact on the tree if carried out incorrectly. Tree preservation orders (TPO's) ensure that trees are not wilfully damaged. However the need for vehicle access over and around tree roots can still cause the following problems:





Problems:

- Compaction of subsoils (especially by construction traffic) causing oxygen and nutrient depletion
- Creating an impermeable surface that prevents water reaching the roots
- Changes in ground level and water table
- Damage caused during excavation
- Contamination of the subsoil



By using CellWeb Tree Root Protection System you can avoid these problems and ensure the tree's long-term future. BS 5837:1991 (revised 2005) and APN 1 provide information for the protection of trees during the construction process, and CellWeb is a well-established solution that conforms to these guidelines.


Product features

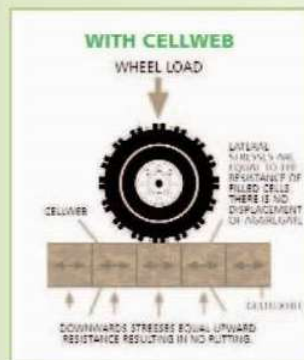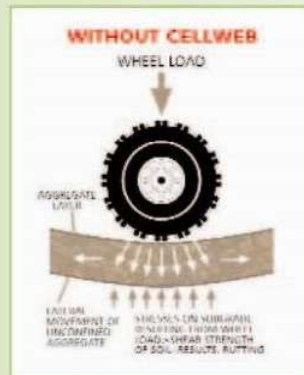

CellWeb's patented design with its unique cellular structure and perforated cell walls reduces the vertical load pressure on tree roots and prevents damage. With clean granular materials as infill, air and moisture can reach the roots to encourage healthy growth.

With no-dig solutions being the preferred option of most Arboricultural Consultants and Tree Officers, CellWeb is ideal as only the surface vegetation need be removed. As well as avoiding disruption to the roots this reduces installation time and saves money.

What's more CellWeb also cuts down the depth required for the sub base – in most cases by 50% for further cost savings. CellWeb also significantly reduces surface rutting, increasing the long-term performance of the finished surface.

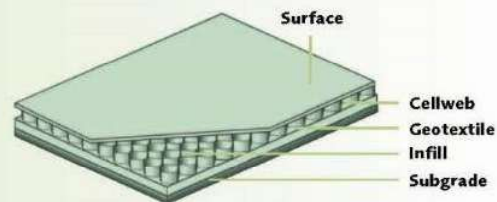

Using CellWeb for tree root protection gives you these benefits:

- Reduced depth of excavation required
- Preventing the compaction of subsoils
- Preventing oxygen and nutrient depletion
- Environmentally sound
- Quick, easy and cost-effective installation
- Free technical support available

CellWeb gives you the cost-effectiveness you need at the same time as helping to preserve trees.

Geosynthetics Ltd is a leading dis

Please call
01455 617 139
or email sales@geosyn.co.uk
for further information.

Wide
product
range

Large
stock
holding

Next day
delivery



Access road for the National Lake District Parks Authority.

Site before construction pictured above.



CellWeb during installation.





Final surfacing.

Final surfacing

The CellWeb Tree Root Protection is totally confined within the clean stone sub base, therefore you can choose whichever surface materials are most appropriate for your installation. Some materials are more suitable than others and serious consideration should be given to the porosity of the surface for continued healthy growth of the tree. An ideal surfacing are DuoBlocks: a grass reinforcement and gravel retention system. Geosynthetics can supply these systems for a visually attractive surface that also has the advantage of being fully porous.

Loose or bonded gravels can be used as an alternative hard landscaping and CellWeb can also be used with block paviors whose porous joints will permit moisture and air transfer to the roots. Where planning allows, porous asphalt is yet another possible surfacing treatment.

Call our sales office on 01455 617 139 for more information.

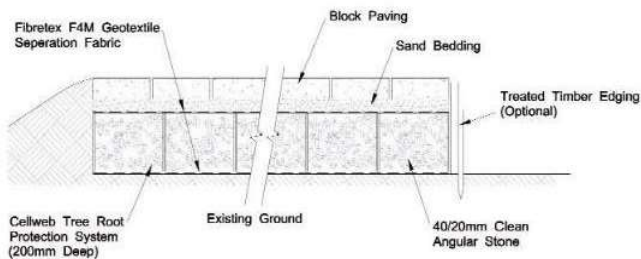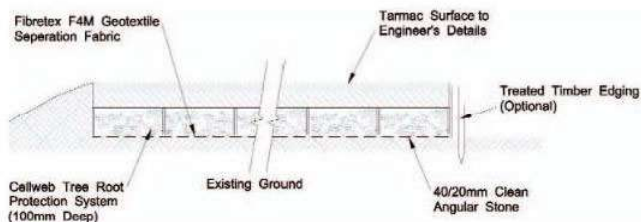

istributor of geosynthetic materials in the UK

Design
service

Onsite
support

See all products
online at
geosyn.co.uk



Geosynthetics

Appendix 3: Section 4, extracted from NJUG 4

4. HOW TO AVOID DAMAGE TO TREES

This section gives general guidance on methods of work to minimise damage to trees. The local authority (or for privately owned trees, the owner or their agent), should be consulted at an early stage prior to the commencement of any works. This will reduce the potential for future conflict between trees and apparatus.

4.1 Below Ground

Wherever trees are present, precautions should be taken to minimise damage to their root systems. As the shape of the root system is unpredictable, there should be control and supervision of any works, particularly if this involves excavating through the surface 600mm, where the majority of roots develop.

4.1.1 Fine Roots

Fine roots are vulnerable to desiccation once they are exposed to the air. Larger roots have a bark layer which provides some protection against desiccation and temperature change. The greatest risk to these roots occurs when there are rapid fluctuations in air temperature around them e.g. frost and extremes of heat. It is therefore important to protect exposed roots where a trench is to be left open overnight where there is a risk of frost. In winter, before leaving the site at the end of the day, the exposed roots should be wrapped with dry sacking. This sacking must be removed before the trench is backfilled.

4.1.2 Precautions

The precautions referred to in this section are applicable to any excavations or other works occurring within the Prohibited or Precautionary Zones as illustrated in Figure 1 – 'Tree Protection Zone'.

4.1.3 Realignment

Whenever possible apparatus should always be diverted or re-aligned outside the Prohibited or Precautionary Zones. Under no circumstances can machinery be used to excavate open trenches within the Prohibited Zone.

The appropriate method of working within the Precautionary Zone should be determined in consultation with the local authority (or for privately owned trees the owner or their agent) and may depend on the following circumstances;

- the scope of the works (e.g. one-off repair or part of an extensive operation)
- degree of urgency (e.g. for restoration of supplies)
- knowledge of location of other apparatus
- soil conditions
- age, condition, quality and life expectancy of the tree

Where works are required for the laying or maintenance of any apparatus within the Prohibited or Precautionary Zones there are various techniques available to minimise damage.

Acceptable techniques in order of preference are;

a) Trenchless

Wherever possible trenchless techniques should be used. The launch and reception pits should be located outside the Prohibited or Precautionary Zones. In order to avoid damage to roots by percussive boring techniques it is recommended that the depth of run should be below 600mm. Techniques involving external lubrication of the equipment with materials other than water (e.g. oil, bentonite, etc.) must not be used when working within the Prohibited Zone. Lubricating materials other than water may be used within the Precautionary Zone following consultation and by agreement.

b) Broken Trench - Hand-dug

This technique combines hand dug trench sections with trenchless techniques if excavation is unavoidable. Excavation should be limited to where there is clear access around and below the roots. The trench is excavated by hand with precautions taken as for continuous trenching as in (c) below. Open sections of the trench should only be long enough to allow access for linking to the next section. The length of sections will be determined by local conditions, especially soil texture and cohesiveness, as well as the practical needs for access. In all cases the open sections should be kept as short as possible and outside of the Prohibited Zone.

c) Continuous Trench - Hand-dug

The use of this method must be considered only as a last resort if works are to be undertaken by agreement within the Prohibited Zone. The objective being to retain as many undamaged roots as possible.

Hand digging within the Prohibited or Precautionary zones must be undertaken with great care requiring closer supervision than normal operations.

After careful removal of the hard surface material digging must proceed with hand tools. Clumps of roots less than 25mm in diameter (including fibrous roots) should be retained in situ without damage. Throughout the excavation works great care should be taken to protect the bark around the roots.

All roots greater than 25mm diameter should be preserved and worked around. These roots must not be severed without first consulting the owner of the tree or the local authority tree officer / arboriculturist. If after consultation severance is unavoidable, roots must be cut back using a sharp tool to leave the smallest wound.

4.1.5 Backfilling

- Any reinstatement of street works in the United Kingdom must comply with the relevant national legislation (see: **Volume 6 – 'Legislation and Bibliography'**). In England this relates to the requirements of the code of practice – 'Specification for the Reinstatement of Openings in Highways' approved under the New Roads and Street Works Act 1991. Without prejudice to the requirements relating to the specification of materials and the standards of workmanship, backfilling should be carefully carried out to avoid direct damage to roots and excessive compaction of the soil around them.
- The backfill should, where possible, include the placement of an inert granular material mixed with top soil or sharp sand (not builder's sand) around the roots. This should allow the soil to be compacted for resurfacing without damage to the roots securing a local aerated zone enabling the root to survive in the longer term.
- Backfilling outside the constructed highway limits should be carried out using the excavated soil. This should not be compacted but lightly "tamped" and usually left slightly proud of the surrounding surface to allow natural settlement. Other materials should not be incorporated into the backfill.

4.1.6 Additional Precautions near Trees

- Movement of heavy mechanical plant (excavators etc.) must not be undertaken within the Prohibited Zone and should be avoided within the Precautionary Zone, except on existing hard surfaces, in order to prevent unnecessary compaction of the soil. This is particularly important on soils with a high proportion of clay. Spoil or material must not be stored within the Prohibited Zone and should be avoided within the Precautionary Zone.
- Where it is absolutely necessary to use mechanical plant within the Precautionary Zone care should be taken to avoid impact damage to the trunk and branches. A tree must not be used as an end-stop for paving slabs or other materials nor for security chaining of mechanical plant. If the trunk or branches of a tree are damaged in any way advice should be sought from the local authority tree officer / arboriculturist.

See TABLE 1 –‘Prevention of Damage to Trees Below Ground’ below for summary details regarding causes and types of damage to trees and the implications of the damage and the necessary precautions to be taken to avoid damage.

TABLE 1 - Prevention of Damage to Trees Below Ground

Causes of Damage	Type of Damage	Implications to Tree	Precautions
Trenching, mechanical digging etc.	Root severance	• The tree may fall over • Death of the root beyond the point of damage • Potential risk of infection of the tree The larger the root the greater the impact on the tree.	Hand excavate only within the Precautionary Zone. Work carefully around roots. Do not cut roots over 25mm in diameter without referring to the local authority tree officer. For roots less than 25mm in diameter use a sharp tool and make a clean cut leaving as small a wound as possible.
Trenching, mechanical digging, top soil surface removal etc.	Root bark damage	• The tree may fall over • If the damage circles the root it will cause the death of the root beyond that point • Potential risk of infection of the tree The larger the root the greater the impact on the tree.	Do not use mechanical machinery to strip the top soil within the Precautionary Zone. Hand excavate only within the Precautionary Zone. Work carefully around roots. Do not cut roots over 25mm in diameter without referring to the local authority tree officer. For roots less than 25mm use a sharp tool and make a clean cut leaving as small a wound as possible.
Vehicle movement and plant use. Material storage within the precautionary area.	Soil compaction & water saturation	Restricts or prevents passage of gaseous diffusion through soil, the roots are asphyxiated and killed affecting the whole tree.	Prevent all vehicle movement, plant use or material storage within the Precautionary Zone.
Top-soil scouring, excavation or banking up.	Alterations in soil level causing compaction or exposure of roots.	Lowering levels strips out the mass of roots over a wide area. Raising soil levels asphyxiates roots and has the same effect as soil compaction.	Avoid altering or disturbing soil levels within the Precautionary Zone.
Use of herbicides.	Poisoning of the tree via root absorption	• Death of the whole tree • Death of individual branches Damage to leaves and shoots.	The selection and application of herbicides must be undertaken by a competent person in accordance with COSHH regulations.
Spillage of oils or other materials.	Contamination of soil	Toxic and asphyxiation effects of chemicals, oils, building materials (cement, plaster, additives etc.) on the root system can kill the tree.	Never store oils, chemicals or building materials within the Precautionary Zone or within the branch spread of a tree, which ever is the greater.
Placement or replacement of underground apparatus.	Various	Death of all or part of the tree.	Effective planning and liaison with local authority tree officer, taking into consideration the position of trees, and their future growth potential and management

4.2 Above Ground

4.2.1 Damage by Pruning

Trees (including shrubs and hedges) can be damaged by inappropriate or excessive pruning. Reference should be made to the Energy Networks Association (ENA) document "Engineering Technical Report 136 Vegetation Management near Electricity Equipment – Principles of Good Practice" (see section 8 – 'Other Useful Publications') or appropriate company specific documentation for guidance on pruning.

See TABLE 2 – 'Prevention of Damage to Trees Above Ground' below for summary details regarding causes and types of damage to trees and the implications of the damage and the necessary precautions to be taken to avoid damage.

TABLE 2 - Prevention of Damage to Trees Above Ground

Causes of Damage	Type of Damage	Implications for the Tree	Precautions
Impact by vehicle or plant Physical attachment of signs or hoardings to the trunk Storage of materials at base of tree Rubbing by winch or pulling cables	Bark bruising, bark removal, damage to the wood, damage to buttress roots, abrasion to trunk	Wounding with the potential for infection ultimately resulting in death of all or part of the tree. Structural failure of the tree	Surround the trunk with protective free-standing barrier. Exclude vehicles, plant or material storage from the Precautionary Zone. Ensure sufficient clearance of cables or ropes.
Impact by vehicle or plant Rubbing by overhead cables	Bark damage to branches, breakage and splitting of branches, abrasion to branches	Structural failure of the branch. Wounding or loss of a branch with the potential for infection ultimately resulting in death of all or part of the branch or tree.	Exclude vehicles, plant or material storage from the Precautionary Zone. Ensure sufficient clearance of cables or ropes. All pruning should be carried out in accordance with BS3998 (<i>prune affected branches to give appropriate clearance from cables</i>)
Inappropriate siting of overhead apparatus, such as CCTV, lighting fixtures and communications masts and dishes.	Inappropriate pruning, unnecessary tree removal	Severely pruning tree to acquire line of sight signal for communications dish etc.	Effective planning and liaison with local authority tree officer / arboriculturist, taking into consideration the position of trees, and their future growth potential and management.
Lack of forethought in design and location of apparatus and services entries on new developments	Complete tree removal	The tree is removed unnecessarily	Agree the location and installation of services at the design stage. Consideration should be given to the creation of dedicated service routes wherever possible.
Use of herbicides	Poisoning of the tree via absorption through bark, leaves and shoots	Death of the whole tree, death of individual branches, damage to leaves and shoots	The selection and application of herbicides must be undertaken by a competent person in accordance with COSHH regulations.

Appendix 4: Programme of Site Monitoring

Wickenden Manor, Sharpthorne

Site Monitoring Form

To be completed by the named arboriculturist and emailed to the client and tree officer at the completion of each operation.

Arboriculturist.....

Client.....

Project Manager.....

Tree Officer.....

(The above to be filled in with names and contact numbers)

OPERATION	TIMING	DATE	COMMENTS
Pre-commencement meeting or contact with project/site manager.	Before any works or pre-works on site, including storage of materials		
Spot check of protective fencing	Before demolition begins		
Spot check of 'no dig' construction of new areas of new access drives and footpaths	During ground works		
Supervision of excavations on edge of RPA of T19	During ground works		
Completion of development	Once all construction activity has been completed		