

Monitoring Details:

Crack and Level Monitoring

Provider Name: My Home Needs

Monitoring Interval: Every 6 weeks

Instruction Date: 12/02/2024

Number of Visits: 6

Reading Date: 30/10/2024

Visits Completed: 5

Date of Issue: 31/10/2024

Visits Outstanding: 1

Client Details:

Client: Sedgwick

Engineer / Handler: -

Job Reference:


Monitored Address:

Address: 22 Wheatsheaf Close, Burgess Hill, West Sussex, RH15 8UT

Front Elevation



Site Plan

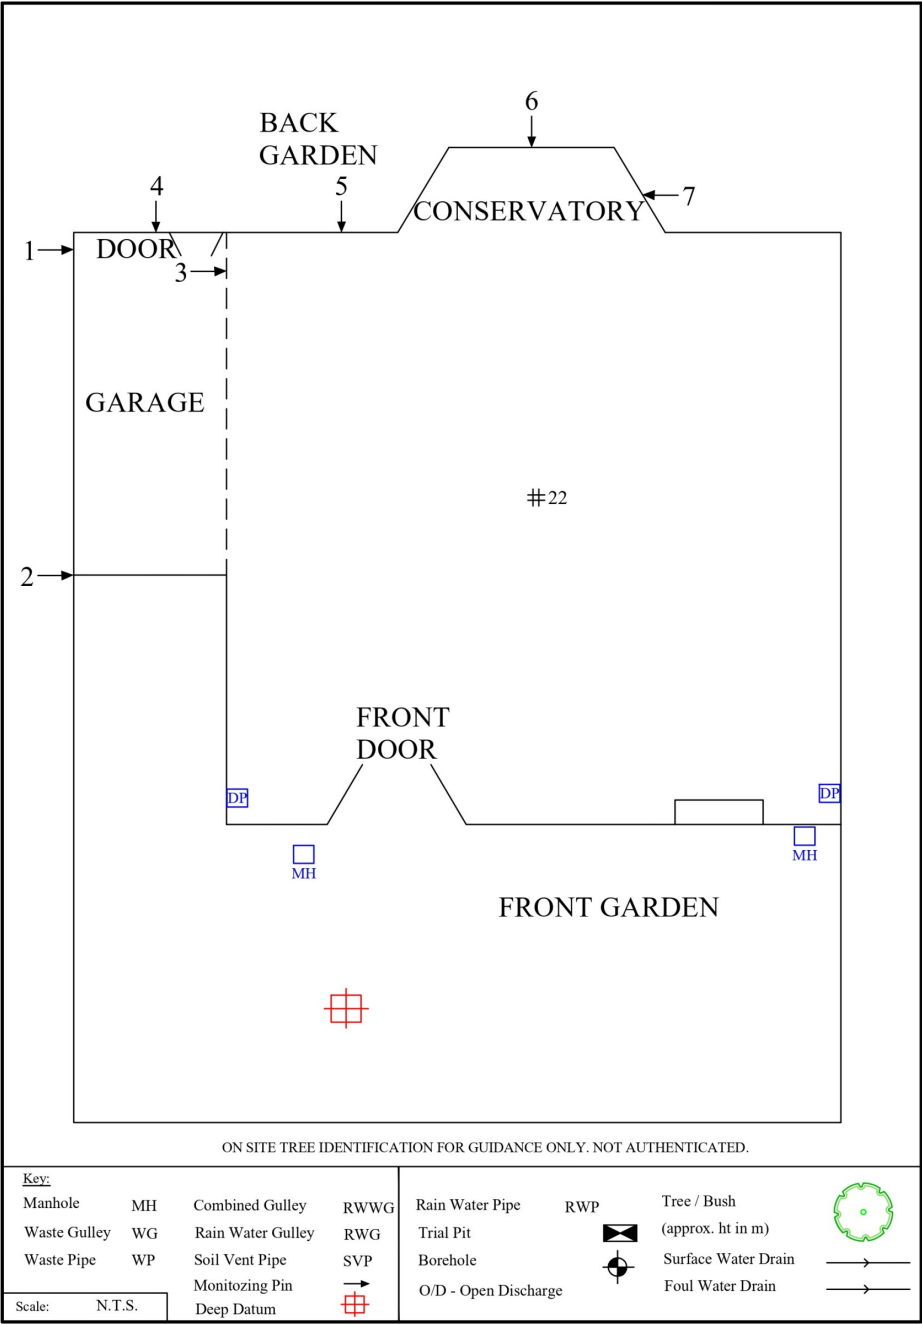

Visit Notes

Visit	Surveyors Note
Visit 5	points 6 and 7 on the conservatory have been double checked


Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	21/02/24	07/04/24	05/06/24	04/09/24	30/10/24			
1	10.0296	10.0274	10.0275	10.0284	10.0297			
2	10.2813	10.2796	10.2793	10.2800	10.2805			
3	10.7056	10.7040	10.7038	10.7053	10.7066			
4	10.4822	10.4806	10.4807	10.4820	10.4825			
5	10.3363	10.3338	10.3344	10.3365	10.3376			
6	10.3611	10.3611	10.3627	10.3627	10.3684			
7	10.3602	10.3590	10.3633	10.3623	10.3701			
Taken by	C.L	DH	AP	TW	GR			
Serial number	709253	001	522903	3713	5281			


Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	21/02/24	07/04/24	05/06/24	04/09/24	30/10/24			
1	0	-2.2	-2.1	-1.2	+0.1			
2	0	-1.7	-2	-1.3	-0.8			
3	0	-1.6	-1.8	-0.3	+1			
4	0	-1.6	-1.5	-0.2	+0.3			
5	0	-2.5	-1.9	+0.2	+1.3			
6	0	0	+1.6	+1.6	+7.3			
7	0	-1.2	+3.1	+2.1	+9.9			

Level Readings Chart (Points 1 - 7)

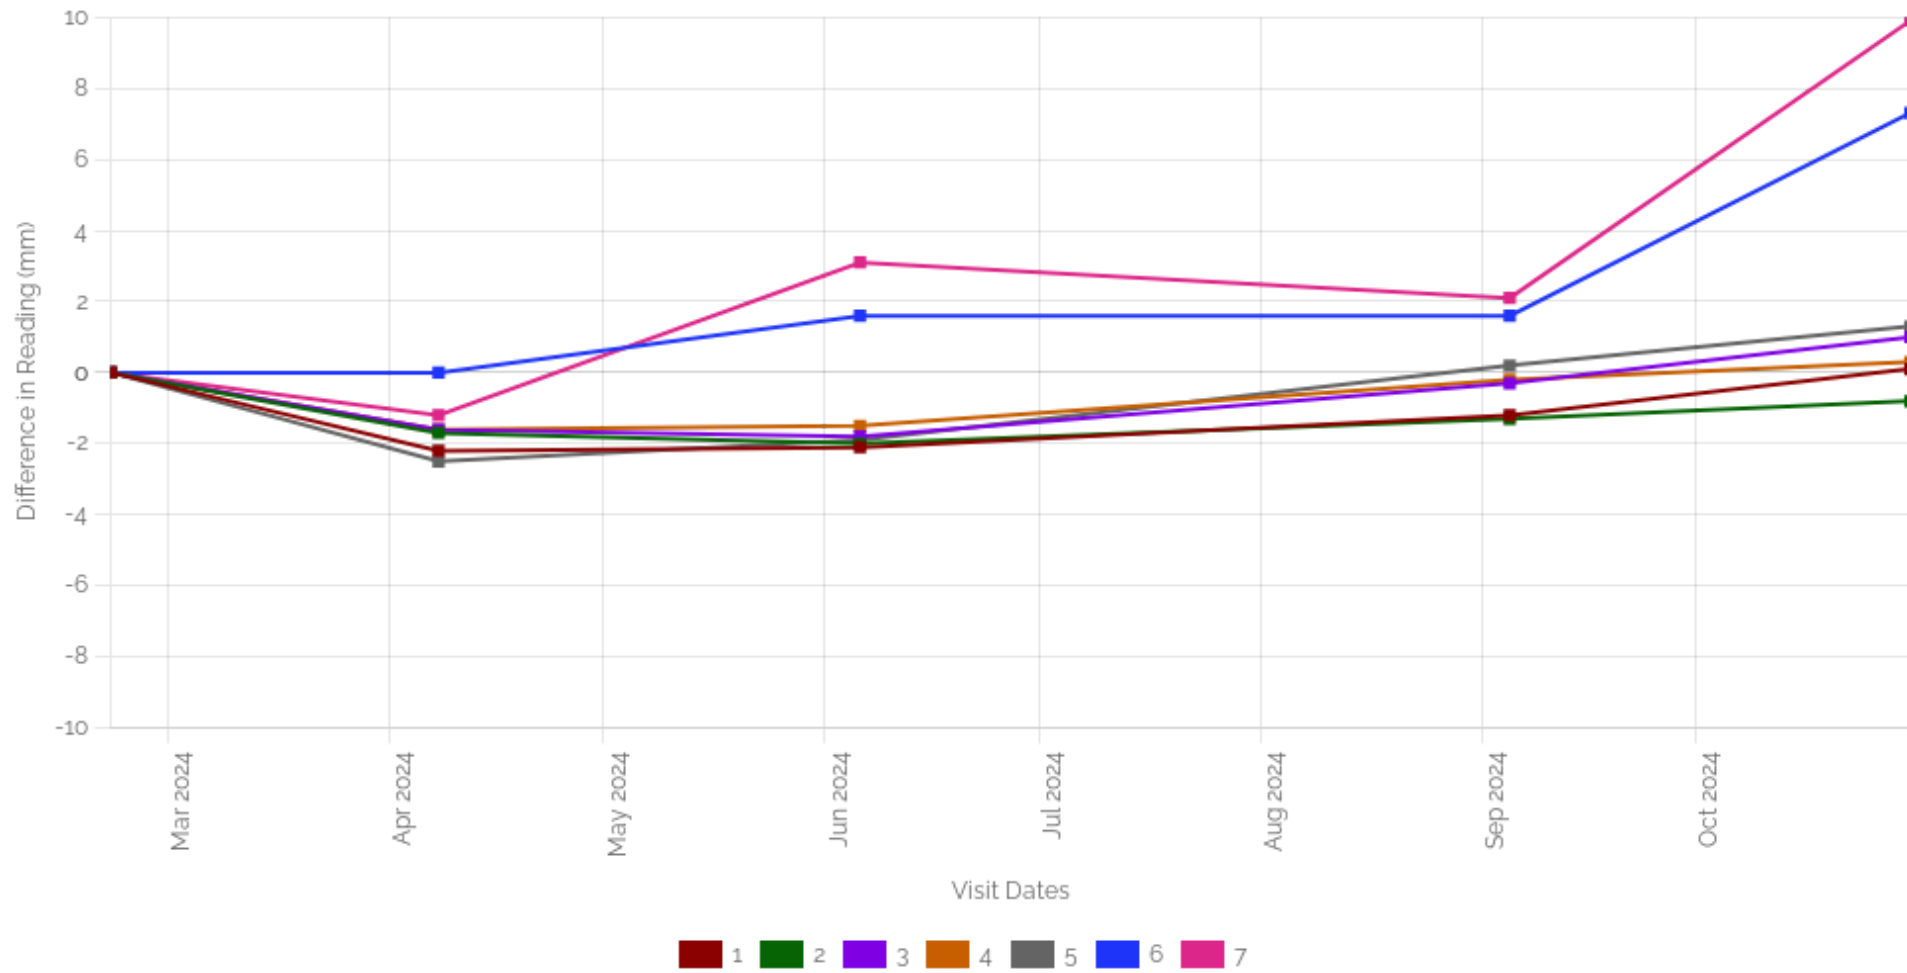

Relative Movement (Relative Survey, for illustration purposes only)

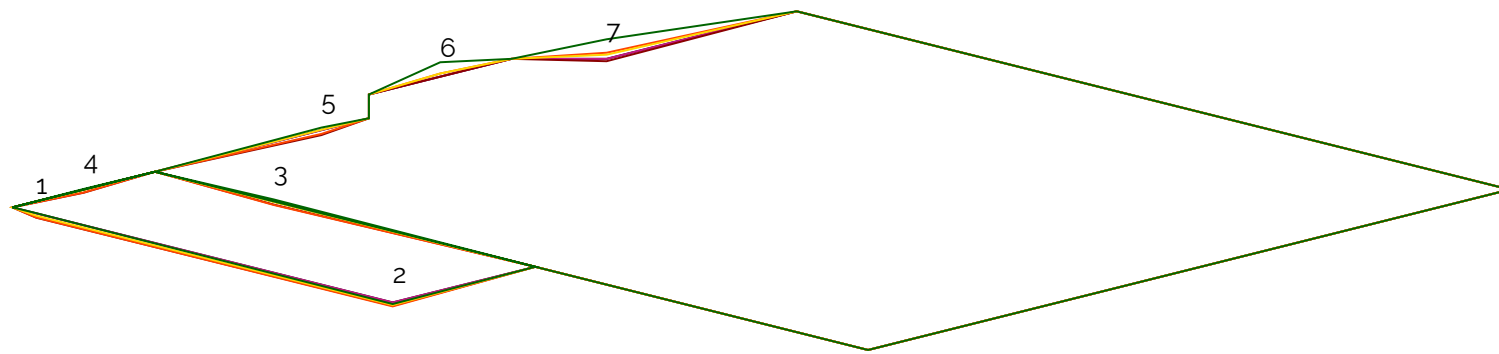

21/02/2024

06/04/2024

04/06/2024

03/09/2024

30/10/2024


Crack Monitoring

INT - Rear elevation in rear lounge

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	21/02/24	07/04/24	05/06/24	04/09/24	30/10/24			
H	4742	472	4754	4762	4768			
Taken by	C.L	D.H	A.P	T.W	GR			
Callipers		9741	0570	1819	4696			

INT - Rear elevation in rear lounge - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	21/02/24	07/04/24	05/06/24	04/09/24	30/10/24			
H	0.22	0	0.34	0.42	0.48			

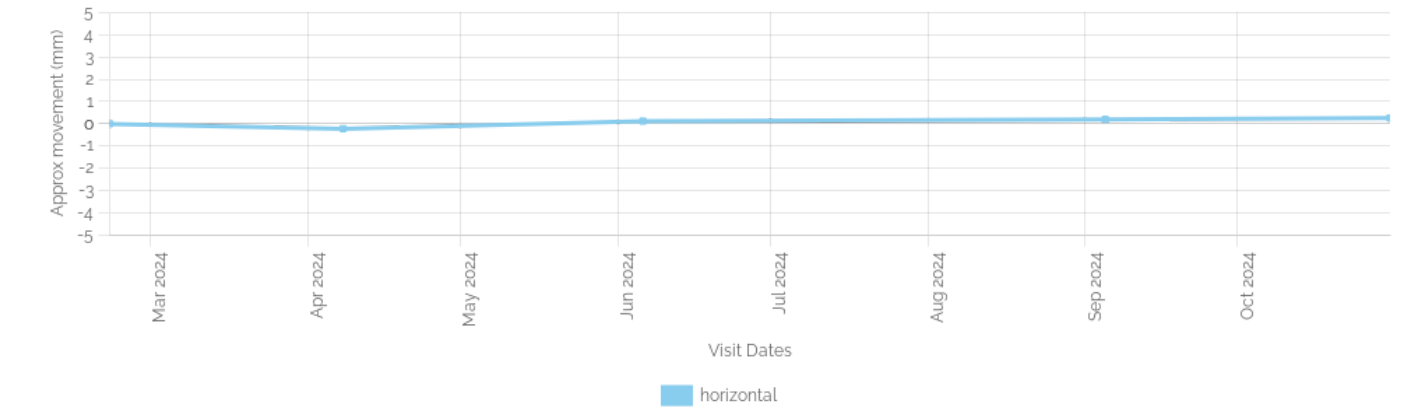

INT - Rear elevation in rear lounge - Visit #2



INT - Rear elevation in rear lounge - Visit #5




Crack Monitoring

INT - Rear elevation in rear bedroom

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	21/02/24	07/04/24	05/06/24	04/09/24	30/10/24			
H	4516	4497	4528	4548	455			
Taken by	C.L	D.H	A.P	T.W	GR			
Callipers		9741	0570	1819	4696			

INT - Rear elevation in rear bedroom - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	21/02/24	07/04/24	05/06/24	04/09/24	30/10/24			
H	0.19	0	0.31	0.51	0.53			

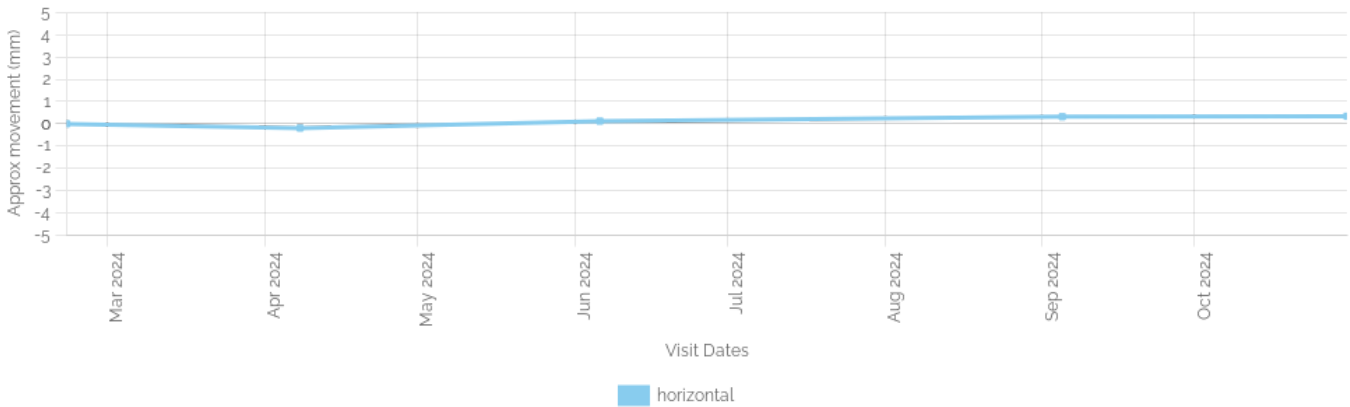

INT - Rear elevation in rear bedroom - Visit #2



INT - Rear elevation in rear bedroom - Visit #5




Crack Monitoring

EXT - Rear elevation above patio door into house

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	21/02/24	07/04/24	05/06/24	04/09/24	30/10/24			
H	7475	7472	7523	7564	756			
V	68.82	68.68	68.93	69.31	69.29			
D	10132	10125	10145	10149	10159			
Taken by	C.L	D.H	A.P	T.W	G.R			
Callipers		9741	0570	1819	4696			

EXT - Rear elevation above patio door into house - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	21/02/24	07/04/24	05/06/24	04/09/24	30/10/24			
H	0.03	0	0.52	0.93	0.89			
V	0.14	0	0.26	0.63	0.62			
D	0.07	0	0.2	0.24	0.35			

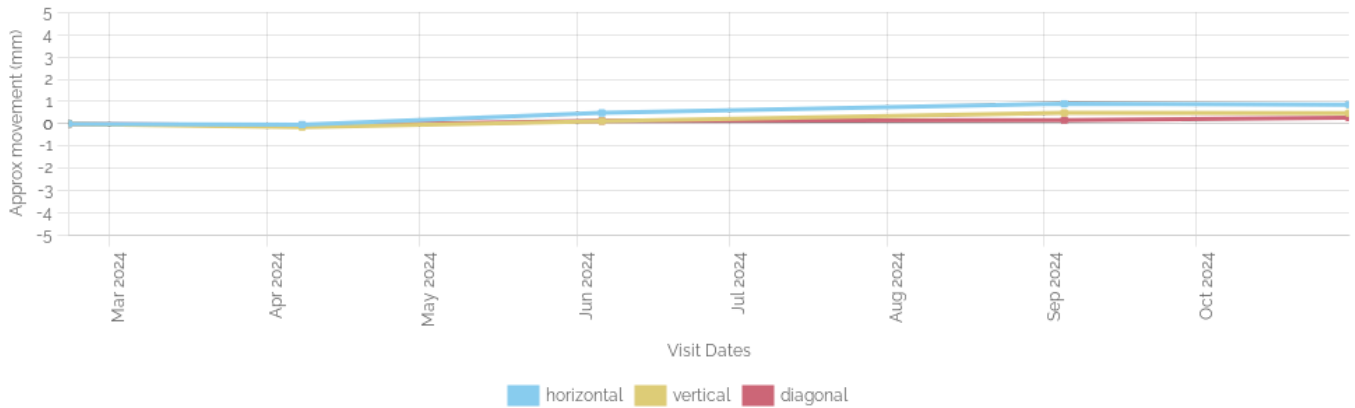

EXT - Rear elevation above patio door into house - Visit #2



EXT - Rear elevation above patio door into house - Visit #5

