

Arboricultural Report

Tree Survey
Arboricultural Impact Assessment
& Tree Protection Plan

Land at
Little Reeds
London Road
Hickstead
RH17 5LY

Prepared by:

The Mayhew Consultancy Ltd

30 Fair Lane
Robertsbridge
East Sussex
TN32 5AS

Tel: 07711 673138

www.cmarb.co.uk

AR/146924

July 2024

Contents

Section	Title	Page
1.0	Summary	3
2.0	Details of survey	4
3.0	Instructions	4
4.0	Site details	5
5.0	Planning history	5
6.0	Protected trees	5
7.0	Documents supplied	5
8.0	Existing trees	6
9.0	Arboricultural Impact Assessment (AIS)	6
10.0	Tree works	7
11.0	Arboricultural Method Statement (AMS)	7
12.0	Post development pressure	8
13.0	Sequence of works	9
14.0	Recommendations	9
15.0	Conclusion	9
Appendix A	Existing tree plan	
Appendix B	Tree protection Plan	
Appendix C	Tree survey schedule	
Appendix D	Tree survey key	
Appendix E	BS 5837:2012 Cascade chart for tree quality assessment	
Appendix F	BS 5837:2012 Figures 2 & 3 - Tree protection barriers	
Appendix G	Sample tree protection warning sign	
Appendix H	1) Scope of this report 2) Survey method	

1.0 Summary

1.1 Site summary:

The subject site is located on land at Little Reeds, London Road, Hickstead, RH17 5LY. The proposal is to create a five-metre-high earth acoustic bund to west of Little Reed with associated landscaping.

1.2 Existing trees (Section 8 refers):

I surveyed three individual trees and thirteen groups of trees, including a western boundary hedge both on and off-site in July 2024.

1.3 Condition of existing trees (Section 9 refers):

No trees were found to be in such a condition that their immediate removal is recommended irrespective of the outcome of this proposal.

1.4 Consequences of development on trees (Section 9 refers):

Part of one internal group of trees would be lost if the proposal were to be implemented.

1.5 Tree Works (Section 10 refers):

No specific tree works are recommended to implement the proposal. However, some minor crown lifting or cutting back may also be required in order to facilitate access.

1.6 Tree Protection (Section 11 refers):

In order to protect the root systems of retained trees during the construction period, the following is recommended:

- The installation of two tree protection barriers

1.7 Conclusion:

If the recommended tree protection measures are installed and adequately supervised, I consider that the proposal can be successfully implemented while protecting the retained trees and hedges to a level which complies with current arboricultural standards.

2.0 Survey details

The Site: Land at Little Reeds, London Road, Hickstead, RH17 5LY

TMC Ref: AR/146924

Local authority: Mid Sussex District Council

Survey date: 1st July 2024

Report date: 17th July 2024

Surveyed by: Clive Mayhew BA (Hons), MICFor, FArbor.A., CEnv

3.0 Instructions

3.1 I have been instructed to:

1. Survey the trees potentially affected by the proposal.
2. Produce an arboricultural report fully compliant with the recommendations contained within 'BS 5837:2012 Trees in relation to design, demolition and construction – Recommendations.'

3.2 My name is Clive Mayhew, and I am the author of this report. I have over 35 years of experience in tree, landscape and ecology management in both the public and private sectors. I am a Chartered Arboriculturist within the Institute of Chartered Foresters, a Chartered Environmentalist, and a Fellow of the Arboricultural Association.

4.0 Site details

- 4.1 **Site description:** The subject site is located on land at Little Reeds, London Road, Hickstead, RH17 5LY.
- 4.2 **Proposal details:** The proposal is to create a five-metre-high earth acoustic bund to west of Little Reed with associated landscaping.
- 4.3 **Existing structures:** There was a residential dwelling, and other associated buildings present at the time of the site visit.
- 4.4 **Existing topography:** The site is generally level throughout, with any topographical variations being made up of historic importation of soils and the creation of artificial bunds.
- 4.5 **Existing vegetation:** In addition to the trees and hedges listed in this report's schedule the site is currently laid to improved grassland.
- 4.6 **Soils:** The soil type is of relevance because soils with a high clay content can be compacted, which in turn can be extremely damaging to tree roots. The British Geological website indicates the bedrock geology to be mudstone from the Weald clay formation. The clay content within such soils is likely to be high, and the tree protection measures advocated in this report are therefore set at the highest level of current technical specifications.

5.0 Planning history

- 5.1 I have been given no specific details of the site's planning history.

6.0 Protected trees

- 6.1 As of 5th July 2024, the Mid Sussex District Council online mapping resource indicates that no trees potentially affected by this proposal are protected by virtue of a tree preservation order.
- 6.2 It should be noted that the legal status of trees can change at any time through the serving of a new Tree Preservation Order or the creation of a Conservation Area, and this should be checked prior to the commencement of any works.

7.0 Documents supplied

- 7.1 I have been supplied with scheme and proposal plans by the client.

8.0 Existing trees

8.1 I surveyed three individual trees and thirteen groups of trees including a western boundary hedge, both on and off-site in July 2024. These have been plotted on the existing tree plan at Appendix A, and described within the schedule at Appendix C.

8.1.1 I classed the trees according to the classifications outlined within BS 5837:2012 'Trees in relation to design, demolition and construction – Recommendations' (See Appendix E).

9.0 Arboricultural Impact Assessment (AIS)

9.1 The recommendations made here relating to tree retention, removal and planting are informed by current arboricultural, planning and urban design best practice, primarily British Standard 5837:2012 'Trees in relation to design, demolition and construction – Recommendations,' which advocates a pragmatic approach to tree removal and retention, based on sustainability.

9.2 Trees requiring removal *irrespective* of the proposal

9.2.1 No trees were found to be in such a condition that their removal is recommended irrespective of the outcome of this proposal.

9.3 Trees requiring removal as a *consequence* of the proposal

9.3.1 The following trees would be lost if the proposal were to be implemented:

9.3.2 G16 – Cypress

Reason for removal: This group is located beneath the footprint of an area of proposed soil importation.

Appraisal: The group in question is a linear planting of topped cypress around the western and southern flank of the existing residential property. The group provides a degree of visual amenity benefit to the interior of the site, but none to any publicly accessible areas beyond the site's boundaries. In addition, views of this group from the A23 public highway are effectively screened by highway tree planting identified within G15 of this report, which will be retained and protected during the development period. As a consequence, I believe the removal of this group is acceptable within the context of the proposal.

10.0 Tree Works

- 10.1 No specific tree works are recommended to implement this proposal. Some minor crown lifting or cutting back may be required, however, in order to facilitate access.
- 10.2 Any works undertaken should comply with the recommendations contained within British Standard 3998:2010 'Tree Work' and undertaken with the consent of the local planning authority – if such consent is required.

11.0 Arboricultural Method Statement (AMS)

11.1 Root Protection Areas (RPAs)

The identification of Root Protection Areas is the primary means by which retained trees are protected on construction sites. No unspecified activity should occur within any prescribed RPA, access should only be permitted with prior approval of the Local Planning Authority, and encroachment should normally only take place if the ground beneath is suitably protected.

- 11.1.1 BS 5837:2012 provides arboriculturists with a method to determine the extent to which excavations associated with construction works might have a damaging effect on the roots of adjacent trees. The Standard enables an RPA to be calculated from the diameter of each retained tree, and this is usually described as a circle with a radius at the prescribed distance from that tree.

11.2 RPAs and the subject site:

- 11.2.1 Some aspects of the proposed development will potentially encroach into the nominal RPAs of retained trees on site, while other activity will occur close to them, and I therefore make the following recommendations regarding specific tree protection measures.

11.3 Protective barriers

- 11.3.1 BS 5837:2012 recommends that the RPAs of the subject trees should be protected by the erection of barriers, the preferred form of which consists of welded mesh 'Heras' type panels 1.8 metres high, mounted on a braced scaffolding frame as detailed in Figure 2 & 3 of BS 5837:2012. (See Appendix F). The barriers should carry laminated signs stating: "Construction exclusion zone – No Access," or similar. (See Appendix G). It is recommended that gaps should be left beneath the bottom of any perimeter site fencing and the ground to allow for the passage of foraging mammals.
- 11.3.2 **The subject site:** The requirement for two Tree Protection Barriers has been identified and these have been illustrated at Appendix B.
- **TPB 1** - This barrier is located around the site boundaries within the northern portion of the site. It is designed to protect the RPAs and stems of trees beyond the barrier from potential damage as a result of construction activity.

- **TPB 2** - This barrier is located around the site boundaries within the southern portion of the site. It is designed to protect the RPAs and stems of trees beyond the barrier from potential damage as a result of construction activity.

11.3.3 It should be noted that the full extent of these barriers need not be in place for the complete duration of the implementation period, **if activity is not occurring in close proximity to individual trees or groups of trees at a particular time**. This aspect of tree protection will be guided by:

- 1) The Project timetable
- 2) Any adopted access plan
- 3) Approval of the supervising arboriculturist – see 14.2 and 14.3 below.

11.4 Demolition

No demolition works are identified as part of this proposal. However, no works of any description should commence until the tree protection measures specified above have been installed.

11.5 Utilities

11.5.1 Where supply of any underground utilities passes through the RPAs of retained trees BS 5837:2015 recommends that detailed plans should be drawn up in conjunction with an appropriately qualified arboriculturist - See Section 7.7.

11.6 Other general activities

11.6.1 Many of the activities which occur on construction sites are potentially damaging to trees. These include the location of site huts, parking arrangements, the storage of materials, the storage of rubbish, and the movement and operation of plant. It is important to understand the range of potentially damaging activities that might occur on a site and ensure at an early stage that these possible conflicts are recognised and avoided. Therefore, areas designated for site huts, parking and storage of materials should be identified prior to the commencement of works.

11.6.2 **The subject site:** There is a generous availability of space within the body of the site to ensure that areas for storage and other aspects of site accommodation are not in conflict with the tree protection measures recommended in this report. However, this aspect of site management should be established and agreed prior to the commencement of works.

12.00 Post development pressure

12.1 When new structures are located near to trees there may be pressure to prune or remove them because of concerns that the trees might fail in some way, or because of perceived shading. Inevitably the tolerance of individuals towards trees varies considerably; one may take exception to the proximity of adjacent trees while another will happily coexist with the same juxtaposition.

- 12.2 **The subject site:** Given the nature of the proposal, I do not consider that the matter of post development pressure directed towards retained trees will be an issue on this site.

13.0 Sequence of works

- 13.1 The sequence of works should be as follows:

1. Tree works
2. Erection of tree protection barriers
3. Construction works
4. Removal of tree protection barriers

14.0 Recommendations

- 14.1 It is recommended that the tree protection measures advocated in this report should be followed at all times. Any deviation should only occur following consultation with the local authority's arboricultural officer, and then only with their specific approval.
- 14.2 It is recommended that a suitably qualified arboriculturist supervises the installation of the tree protection measures and confirms that they comply with BS 5837:2012, and if necessary, briefs the individual who will be responsible for the maintenance of tree protection measures for the duration of the works.
- 14.3 An individual should be identified as a point of contact for arboricultural matters for the duration of the works. This individual will need to be familiar with the arboricultural constraints presented by the site, the tree protection measures that have been installed, and the requirement to keep those measures adequately monitored and maintained.

15.0 Conclusion

- 15.1 I consider that this scheme is acceptable in arboricultural terms and that the subject trees can be protected according to current standards, providing the recommended mitigation measures are adopted.



-  Category A tree
-  Category B tree
-  Category B group
-  Category C tree
-  Category C group

The Mayhew Consultancy Ltd
 30 Fair Lane, Robertsbridge
 East Sussex TN32 5DA
 Tel: 01580 881092 Mobile: 07711 673138
 E-mail: clive@cmarb.co.uk

AR/146924 - Little Reeds
 London Road, Hickstead, RH17 5YL
Existing Tree Plan
 July 2024
 Do not scale from drawing



-  Category A tree
-  Category B tree
-  Category B group
-  Category C tree
-  Category C group
-  Area of proposed soil importation
-  Root protection area
-  Tree protection barrier

The Mayhew Consultancy Ltd
 30 Fair Lane, Robertsbridge
 East Sussex TN32 5DA
 Tel: 01580 881092 Mobile: 07711 673138
 E-mail: clive@cmarb.co.uk

AR/146924 - Little Reeds
 London Road, Hickstead, RH17 5YL
Tree Protection Plan
 July 2024
 Do not scale from drawing

Tree Survey – 1st July 2024

Tree No	Species	Height	Stem dia.	RPA Rad	RPA Area	Crown spread N – S – E - W				CB	Age	Phy con	Str con	ECR	Class	Notes
G1	Oak	<16	<70	8.4	222	As per plan				4	M	G	G	L	B	Boundary line of established oaks.
G2	Blackthorn	<6	<20	2.4	18	As per plan				GL	M	G	F	M	C	Linear understory boundary planting.
T3	Oak	14	100	12.0	452	11	12	10	10	3	M	G	G	L	A	Fine, broad crowned tree.
G4	Mixed broadleaved	<9	<35	4.2	55	As per plan				Var	SM	F	F	M	C	Generally unexceptional linear boundary planting. Ash dieback evident.
T5	Oak	18	100	12.0	452	12	12	9	9	4	M	G	F	L	B	Established tree. Crown lifted in past.
G6	Mixed broadleaved	<10	<30	3.6	41	As per plan				Var	SM	G	G	M	B	Good, dense linear planting. Ash dieback evident.
T7	Ash & hawthorn	<12	<50	6.0	113	6	7	5	6	1	SM	G	F	M	C	Established pair of trees. Ash dieback evident.
G8	Mixed broadleaved	<12	<35	4.2	55	As per plan				Var	SM	G	G	L	B	Dense highway boundary planting to A23. Includes 1x eucalyptus.
G9	Cypress	<14	<40	4.8	72	As per plan				Var	SM	G	F	L	C	Mixed species linear boundary group – predominately topped cypress.
G10	Oak x 2	<18	<70	8.4	222	As per plan				5	SM/ M	G	F	L	B	2 x trees to rear of building. Topped cypress understory.

Tree No	Species	Height	Stem dia.	RPA Rad	RPA Area	Crown spread N – S – E - W	CB	Age	Phy con	Str con	ECR	Class	Notes
G11	Oak	<15	<80	9.6	290	As per plan	Var	M	G	F	L	B	Linear oak boundary planting with topped cypress beneath.
G12	Oak	<14	<80	9.6	290	As per plan	Var	M	G	F	L	B	Linear oak boundary planting with blackthorn and field maple beneath.
G13	Blackthorn & field maple	<8	<30	3.6	41	As per plan	Var	M	F	F	M	C	Linear boundary planting, with some adjacent young oaks at southern end.
G14	Oak	<16	<70	8.4	222	As per plan	Var	SM	G	G	L	B	Small triangular plantation of semi-mature oaks.
G15	Mixed broadleaved	<10	<30	3.6	41	As per plan	Var	SM	G	G	L	B	Dense highway boundary planting to A23.
G16	Cypress	<8	<30	3.6	41	As per plan	Var	SM	F	F	L	C	Topped cypress, forming boundary screen and internal site division.


Survey sheet key

Tree No	Tree reference number as used in the report and survey plan T = Tree G = Group H = Hedge W = Woodland
Ht	Tree height in metres
Stem dia.	Stem diameter in millimetres Measured at 1.5 metres above ground level, or immediately above the root flare of multi-stemmed trees M = Multi-stemmed tree
Crown sp	Crown spread measured in metres from the stem to the four compass points
Crown break	Height of crown clearance above adjacent ground level, given in metres
Age class	Age class Y = Young: Staked or newly established tree SM = Semi-mature: An established tree at a stage of rapid growth EM = A tree nearing its ultimate canopy size for its situation M = Mature: A tree at its ultimate canopy size for its situation OM = Over mature: A mature tree smaller than its ultimate canopy size, often such trees are of great historical or ecological importance.
P. Con	Physiological condition of the tree expressed through an assessment of its general well-being G = Good, F = Fair, P = Poor, D = Dead
S. Con	Structural condition of the tree G = Good, F = Fair, P = Poor, D = Dangerous
R.C.	Estimated remaining contribution expressed in years D = <10, S = 10-20, M = 20-40, L = >40
BS Cat	Tree category graded as per the guidance given within Table 1 of BS 5837:2012 – See Appendix E A - Green = Trees of high quality with an estimated remaining life expectancy of at least 40+ years B - Blue = Trees of moderate quality with an estimated remaining life expectancy of at least 20 years C - Grey = Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm U – Red = Trees in such a condition that they cannot be realistically retained for longer than 10 years.
RPA ~ R	Root Protection Area radius, as measured in metres from the centre of the tree
RPA ~ A	Root Protection Area expressed in square metres

BS 5837:2012 Table 1 – Cascade chart for tree quality assessment

Category and Definition	Criteria (including subcategories where appropriate)			Identification on plan
Trees unsuitable for retention				
Category U Trees in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years.	- Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning) - Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline - Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality NOTE Category U trees can have existing or potential conservation value which it might be desirable to preserve.			DARK RED
	1. Mainly arboricultural values	2. Mainly landscape values	3. Mainly cultural values, including conservation	
Trees to be considered for retention				
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups, or of formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture)	LIGHT GREEN
Category B Trees of moderate quality with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality	Trees with material conservation or other cultural value	MID BLUE
Category C Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater landscape value; and/or trees offering low or only temporary/transient landscape benefits	Trees with no material conservation or other cultural value	GREY

BS 5837:2012 - Tree protection fencing

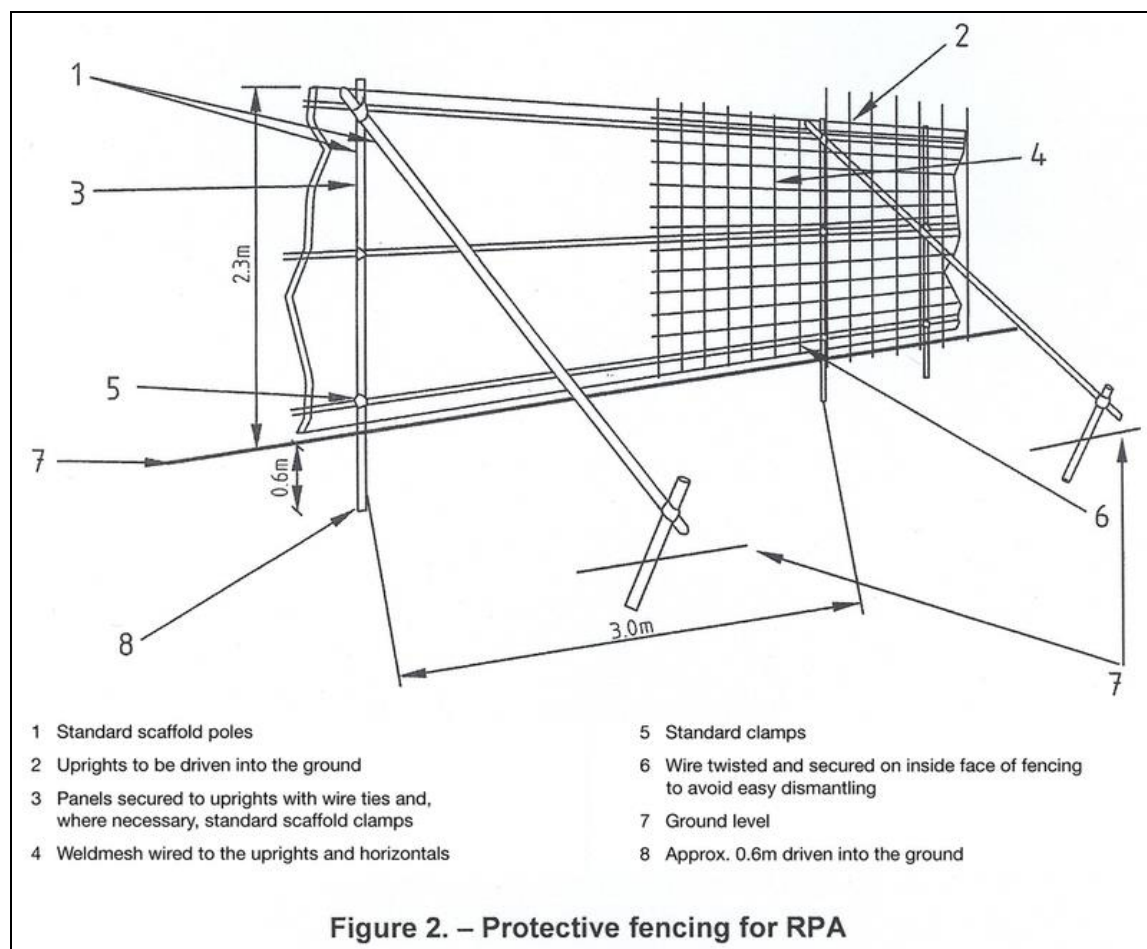

On site examples of appropriate tree protection fencing installed as recommended within BS5837

Tree protection area warning sign



1.0 Scope of this report

- 1.1 I have been commissioned to produce base line survey data for trees, with a view to identifying constraints and opportunities for sustainable tree cover in the context of the development proposal for the site. The survey has been undertaken in accordance with British Standard 5837:2012 'Trees in relation to design, demolition and construction - Recommendations' and was made in the context of the site's current usage.
- 1.2 This report comprises the prerequisite information for the planning process recommended in BS 5837:2012
- The production of a Tree Survey
 - The production of an Arboricultural Impact Assessment
 - The production of a Tree Protection Plan if required.
 - The production of an Arboricultural Method Statement, if required.
- 1.3 The tree locations and canopy spreads are plotted on the indicative plans at Appendix A.
- 1.4 A detailed condition survey or hazard assessment of each tree has not been undertaken within the scope of this report. If a tree was noted as being in such a condition as to require more detailed assessment, then that observation is included in the tree survey notes at Appendix B.
- 1.5 The findings within this report have been made on the basis of evidence seen on the day of inspection. It should be understood that some indications of tree hazard, such as leaf appearance and density, fungal fruiting bodies, and specific pests and diseases, are only visible at specific times of the year. Should significant additional information become apparent following the submission of this report I would reserve the right to modify the conclusion made accordingly.
- 1.6 This report is valid until:
- The re-inspection dates given for any tree in the survey schedule
 - An episode of adverse weather conditions - for example winds over land measured at Beaufort scale force 8 or above.
 - For two years from the date of inspection.
- Whenever any of the above occurs first, the trees must be re-inspected, and any recommendations carried out. The presence of a hazard, the probability of harm and the value of the target area all help to determine the frequency of re-inspection.
- 1.7 Some trees are protected in law. Prior to any works to trees being undertaken a check should be made with the relevant Local Authority to ensure that prior permission is not required with regard to Tree Preservation Orders (TPOs), Conservation Areas (CAs) or planning conditions that may affect the site or its trees.
- 1.8 Works to trees can also be regulated because of the risk of harming wildlife which may live on, or around them. Wild birds and bats are protected under the Wildlife and Countryside Act (1981) for example, and it is an offence to knowingly disturb their nests or roosts, while works to trees in proximity to badger setts may require a license.
- 1.9 Any tree works should be undertaken in accordance with British Standard 3998:2010 'Tree work - Recommendations'.

1.10 If hard surfacing needs to be installed close to trees the principles prescribed in BS 5837:2012 and modified specifications contained within Arboricultural Practice Note 12, 'Through the Trees to Development,' should be adopted.

1.11 My expertise is within the field of arboriculture and this report is limited to the arboricultural aspects of the site only. Any comments made with regard to other matters are from a lay person's point of view.

2.0 Survey method

2.1 Each tree was inspected from ground level, noting only external features and defects. The Visual Tree Assessment (VTA) method was used to carry out the tree survey; this is an industry standard, best practice method for assessing the health, stability and, to some degree, the amenity of urban trees. A tree may be physiologically healthy, with vigorous growth, but also exhibit mechanical defects and therefore be structurally weak, consequently presenting a risk. VTA involves an assessment of each tree's physiological and structural condition. It is carried out from ground level, with the aid of binoculars as necessary.

2.2 No climbing inspection was made of the crown, no excavation was made of the root system, and no specific decay detection equipment was used.

2.3 The following instruments were available to carry out the inspection:

- Diameter tape – To measure stem diameters
- Nylon headed mallet – To sound trees for audible indications of decay
- Steel probe – To indicate the presence and extent of cavities
- Binoculars – To visually inspect above ground parts of the tree

2.4 No soil samples were taken, and no tissue samples were collected.

2.5 The following publications have been used to inform this survey, and the recommendations which follow from it:

1. British Standard 5837:2012
'Trees in relation to design, demolition and construction – Recommendations.'
2. British Standard 3998:2010 'Tree work - Recommendations.'
3. 'Diagnosis of ill-health in trees' by R.G. Strouts and T.G. Winter.
DoE booklet Research for Amenity Trees No. 2, 1994.
4. 'The body language of trees - A handbook for failure analysis'
by C. Mattheck and H. Breloer.
DoE booklet Research for Amenity Trees No. 4, 1994.