



ARBORICULTURAL SURVEY

**40 Mytten Close
Cuckfield
Haywards Heath
RH17 5LN**

Document date: 17th December 2025

Document ref: PJC/7058/25-01 Rev -

Sussex Office
Rocks Yard, Victoria Road
Herstmonceux, East Sussex.
BN27 4TQ.

PJC Consultancy Ltd
www.pjcconsultancy.com
contact@pjcconsultancy.com
01233 225365 - 01323 832120

Kent Office
The Watermill, The Mill
Business Park, Maidstone
Road, Ashford, Kent.
TN26 1AE

This report has been prepared by
PJC Consultancy Ltd
on behalf of
Gould Baxter

Document author


Nick Hollett Level 3 BTEC ND Forestry and Arboriculture

Nick has a level 3 National Diploma in Forestry and Arboriculture, and Level 2 BTEC Foundation Diploma Countryside and Environment. He has fifteen years experience in the arboricultural industry, and started his career as a forestry worker and Millworker before progressing as a tree surgeon, working in both the private and commercial sectors. He is a LANTRA accredited professional tree inspector.

Checked by

Peter Davies FdSc Arboriculture M.Arbor.A

Peter has a Foundation Degree in Arboriculture from the University of Brighton and is a professional member of the Arboricultural Association. He has over sixteen years' experience in the arboricultural industry, originally working as a groundsman and feller, and progressing into consultancy. He is a LANTRA accredited professional tree inspector.

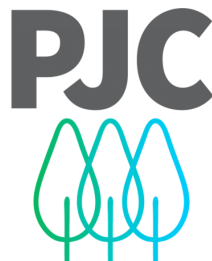

arboriculture . ecology . landscape



CONTENTS

1	INTRODUCTION	4
1.1	Instruction	4
1.2	Survey objectives	4
1.3	Contents of report	4
1.4	Documents and information provided.....	4
2	SURVEY METHODOLOGY	5
2.1	Tree survey information.....	5
2.2	Tree categorisation	5
2.3	Root protection areas	6
2.4	Limitations of survey.....	7
3	SITE VISIT AND SURVEY FINDINGS.....	8
3.1	Site visit.....	8
3.2	Site layout.....	8
3.3	Statutory tree protection.....	8
3.4	Findings.....	8
	Appendix 1: Tree Constraints Plan	9
	Appendix 2: Tree Survey Schedule	10
	Appendix 3: Cascade Chart for Tree Quality Assessment	11



1 INTRODUCTION

1.1 Instruction

- 1.1.1 PJC Consultancy was instructed by Gould Baxter to provide an initial arboricultural survey of 40 Mytten Close, Cuckfield, Haywards Heath, RH17 5LN. The survey has been undertaken in accordance with BS5837: 2012 'Trees in relation to design, demolition and construction – Recommendations'.

1.2 Survey objectives

- 1.2.1 This survey has been undertaken with the following objectives:
- To survey all trees within and adjacent to the site with trunk diameters of 75mm or more at a height of 1.5m.
 - To assess the quality and value of the existing tree stock in terms of arboricultural, landscape, historical/conservation, or public amenity value.
 - To provide information relating to planning constraints that may restrict works to trees at the site.
 - To provide an assessment of the material constraints posed by the existing tree stock on potential future developments at the site.
 - To aid the design process, ensuring prospective developments integrate appropriately with the existing tree stock, to maximise the potential of the proposed development site.

1.3 Contents of report

- 1.3.1 This report includes the following:
- A summary of the existing tree stock and notable arboricultural features.
 - Tree constraints plan in accordance with BS5837: 2012.
 - Tree survey schedule containing the relevant measurements and information for each tree or tree group as required in BS5837: 2012.

1.4 Documents and information provided

- 1.4.1 The following documents were used to aid the preparation of this report:
- City Geomatics Ltd - Topographical Survey ref: 24192-T.



2 SURVEY METHODOLOGY

2.1 Tree survey information

2.1.1 The following information was recorded in the tree survey schedule for each individual tree (average dimensions are recorded for groups):

- Tree reference number. (T=tree, G=group).
- Species (common and scientific name).
- Overall tree height (m).
- Stem diameter (mm) per stem or average diameter for multi-stemmed trees with six or more stems.
- Branch spread (m) measured to the four cardinal points.
- Existing height (m) above ground level of lowest significant branch and direction of growth (for individual trees only).
- Existing height (m) above ground level of canopy.
- Age class (young, semi mature, early mature, mature, over mature or veteran).
- Physiological condition (good, fair, poor).
- Structural condition (good, fair, poor).
- Comments (general description of tree(s) including any notable features).
- Preliminary management recommendations (prescriptions for tree management processes based on the current land use and not related to the prospective development).
- Tree categorisation (see below).
- Root protection area (m²).
- Root protection radius (m).

2.2 Tree categorisation

2.2.1 The condition and value of each tree was evaluated based on the current land use. Each tree or tree group has been awarded either category A, B, C or U and a subcategory of either 1,2 or 3 or a combination of the subcategories.

2.2.2 Tree categorisation summary:

- A – Trees of good condition and high arboricultural, landscape or conservation value. Must have a potential life span in excess of forty years.
- B – Trees of moderate condition, with minor defects or sub-optimal form but are still of modest arboricultural, landscape or conservation value. Must have a potential life span in excess of twenty years.
- C – Unremarkable trees of poor condition or form with limited arboricultural, landscape or conservation value, or trees with a stem diameter under 150mm. Must have a potential life span in excess of ten years.
- U – Trees of such impaired condition that they cannot realistically be retained as living trees in the context of the current land use for more than ten years. These trees do not need to be removed if they are not dangerous and do not conflict with the proposed development, but should not be considered a constraint to development.



2.2.3 Tree sub categorisation summary:

- 1 – Trees have mainly arboricultural value, e.g. trees of good condition, form and vitality or rare tree species.
- 2 – Trees have mainly landscape value, e.g. trees of landscape prominence, that serve to screen unsightly views or that are required for privacy. Also trees present in groups that attain higher collective rating than they would as individuals.
- 3 – Trees with mainly cultural value including conservation, e.g. commemorative trees, trees of historical significance or veteran trees.

2.2.4 Each tree can only be categorised as A, B or C but may comply with more than one subcategory. A cascade chart further explaining how tree categorisation is decided is included in Appendix 3.

2.3 Root protection areas

2.3.1 A root protection area represents a calculation of the minimum volume of rooting medium required to support a tree. It is a standardised calculation based on the stem diameter(s) measured at 1.5m and is not necessarily representative of the actual root spread or total rooting area of a tree. The formulas used to calculate root protection areas are shown below:

Table 1: Root protection area formulas

Number of stems	Root protection area formula
Single stemmed trees	$\frac{(\text{stem diameter (mm)} \times 12)^2 \times \pi}{1000}$
Trees with two to five stems	$\sqrt{(\text{stem diameter } 1)^2 + (\text{stem diameter } 2)^2 \dots + (\text{stem diameter } 5)^2}$
Trees with more than five stems	$\sqrt{(\text{mean stem diameter})^2 \times \text{number of stems}}$

2.3.2 The root protection areas are plotted onto the tree constraints plan in Appendix 1 and are recorded in the tree survey schedule in Appendix 2. These are represented as a circle on the plan (unless significant rooting constraints are present), and are colour coded depending on the category the tree has been awarded. Where existing site conditions/features are present that are deemed likely to have affected the root morphology, the root protection areas have been represented as a polygon of equivalent area.

2.3.3 The proposed layout should avoid level changes or the placement of new buildings and areas of hard standing within the root protection areas of retained trees. In certain situations, engineered solutions are available to allow construction within the root protection areas however further input from an arboriculturist should be sought regarding their site-specific viability before these methods are relied upon.

2.3.4 The disturbance of a tree's root system can result in crown dieback and even death of the tree. Roots are used to support the tree structurally as well as the absorption of moisture and nutrients from the soil. They also act as storage and transport for water and nutrients.

2.3.5 Direct damage such as root severance can lead to ill health, as can compaction of the soil by construction traffic, heavy plant and storage of materials. Changing the nature of the surface above the growing medium, (i.e. from porous to non-porous), can alter the resources available to the tree, which in turn can lead to its decline.



2.3.6 The majority of root growth is usually found within the top 600mm of soil. As such, even a shallow disturbance within a root protection area can potentially have a significant impact on the tree.

2.3.7 The root protection areas must be left free from excavation and disturbance and protected from compaction or contamination during any proposed works. Any construction works within a root protection area required for the proposed development must be justifiable within an arboricultural impact assessment.

2.4 Limitations of survey

2.4.1 The survey methodology was restricted to a visual tree assessment from ground level. No tree climbing or invasive ground investigation was carried out for this report. Where existing site constraints are present such as ivy covered trees, a very dense under-storey, or where trees are located on third party land to which access was not granted, tree dimensions were estimated by eye as accurately as possible.

2.4.2 This survey represents a preliminary overview of the condition and value of trees at the site. It is not a detailed assessment of any individual tree and although preliminary management recommendations are included, this report will not be sufficient to be used as a detailed condition and safety survey.

2.4.3 The information and measurements in this report are representative of the date of the site visit. The tree survey data will need to be updated to reflect tree growth and changes in the condition of the trees after prolonged periods.



3 SITE VISIT AND SURVEY FINDINGS

3.1 Site visit

- 3.1.1 A site visit was carried out on 16th December 2025. The weather conditions at the time were dry and overcast. The visibility was adequate for visual tree inspection from ground level. Deciduous trees were not in leaf.

3.2 Site layout

- 3.2.1 The site is situated to the north of Mytten Close and features a detached dwelling. Access to the site is provided by a driveway that leads from Mytten Close to a parking area and a series of garages. Bordering the driveway is a variety of mixed vegetation and a substantial oak tree can be found in the neighbouring garden to the west. The surrounding area is predominantly residential, with houses occupying all adjacent sides of the site. Additionally, there is an alleyway that runs parallel to the western boundary of the property.
- 3.2.2 None of the trees surveyed for this report were assessed to be ancient or veteran specimens.

3.3 Statutory tree protection

- 3.3.1 Mid Sussex District Council's online mapping tool was used on 17th December 2025 to check whether there are any tree preservation orders (TPOs) within the site. No TPOs were shown to protect trees within the site, however, tree preservation order Ref: CU/01/TPO/72-G1 was shown to cover trees located in the rear garden of property no32 located immediately adjacent to the west of site. The trees covered by the preservation order have not been included as part of this report, and it is considered that their root protection areas do not extend into site.
- 3.3.2 The online mapping tool can be updated at any time, therefore any persons proposing to undertake tree works should still check the status of the trees with the local planning authority prior to undertaking any tree works. Failure to adhere to the TPO legislation could lead to prosecution and if convicted a fine and criminal record. The crown of a tree and its roots are protected. The person carrying out the works, the person instructing the works and the Directors of that company are potentially liable. Failure to check whether tree/s are the subject of TPO/s could not be used as mitigation.
- 3.3.3 The site is not located within a Conservation Area.

3.4 Findings


- 3.4.1 A total of four individual trees and three tree groups were surveyed. Their locations are shown on the tree constraints plan at Appendix 1 and details and measurements are shown in the tree survey schedule at Appendix 2.
- 3.4.2 A summary of their British Standard categorisation is shown at Table 2 below.

Table 2: Tree categorisation summary

Tree category	Individual tree	Tree group
A	1	-
B	1	-
C	2	3
U	-	-
Total	4	3



Appendix 1: Tree Constraints Plan

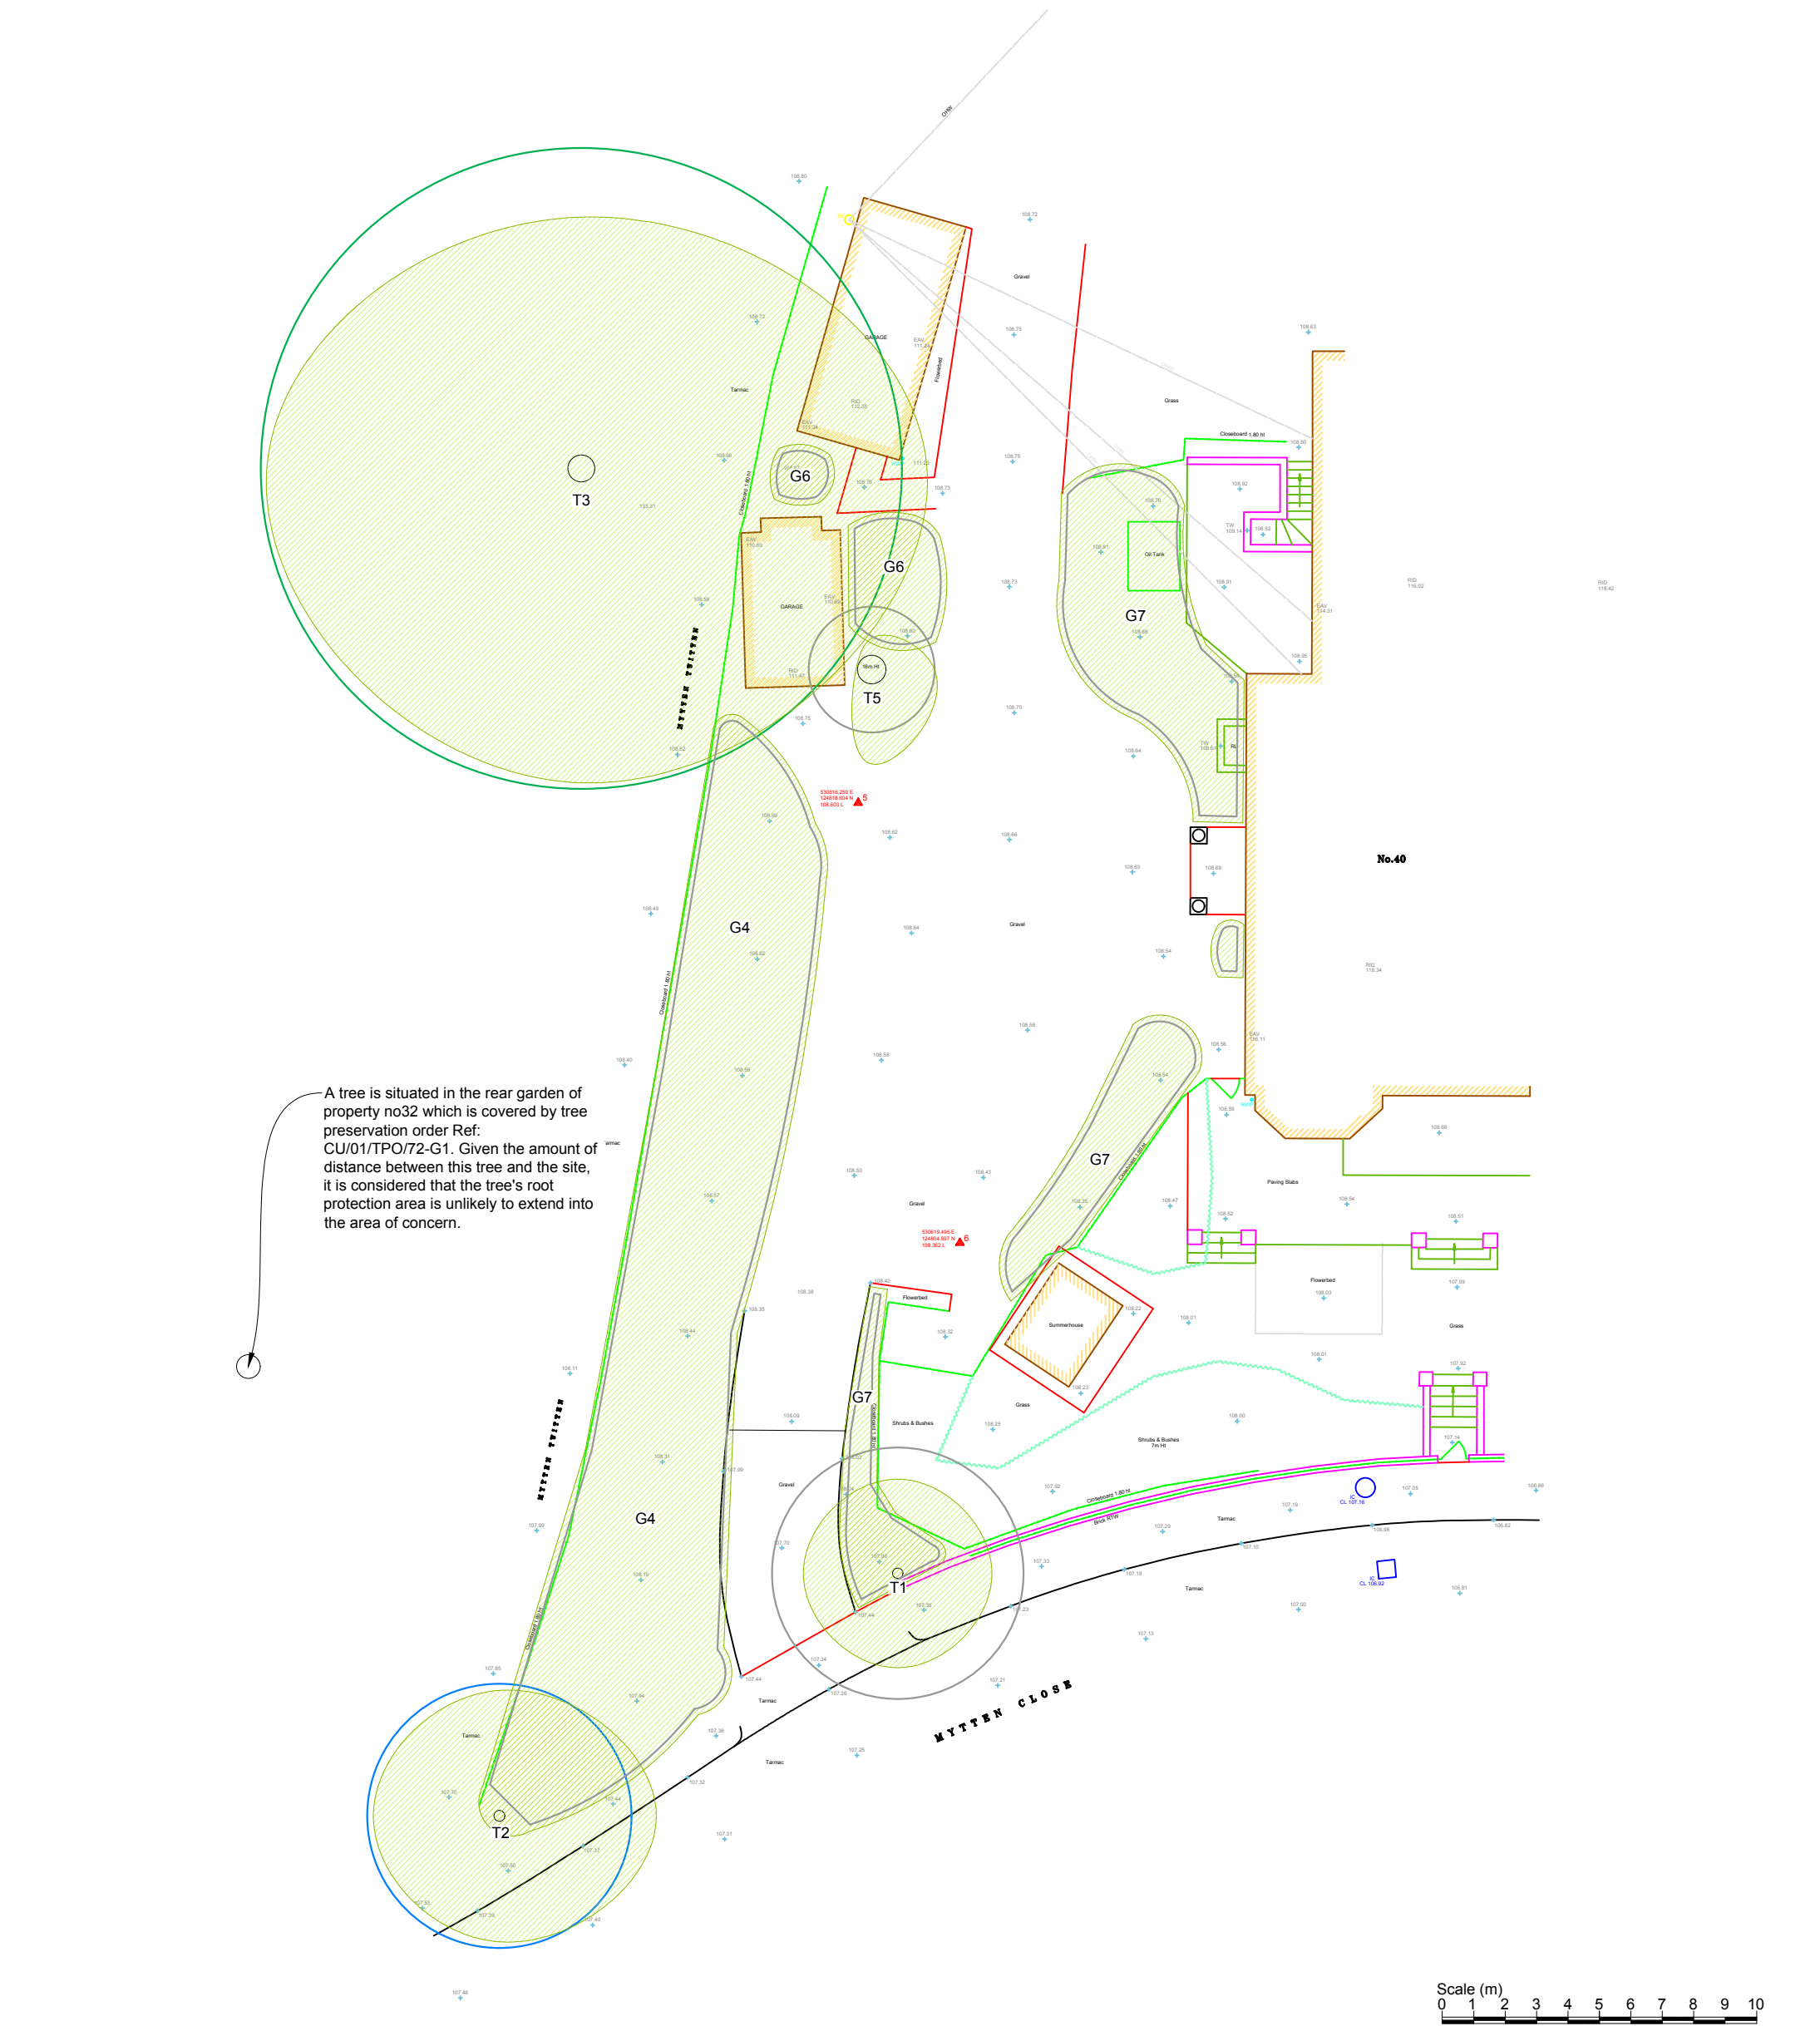

* Tree categorised in accordance with BS 5837:2012 'Trees in relation to design, demolition and construction - Recommendations'.

Tree survey schedule contains further information for each tree.

This drawing should be viewed in colour.

- Key:**
- Root protection area for category A* tree
 - Root protection area for category B* tree
 - Root protection area for category C* tree
 - Tree canopy

Drawing no: PJC/7058/25/A	Rev: -	Sheet number: 1 of 1
Site:		
40 Mytten Close Cuckfield Haywards Heath RH17 5LN		
Drawing title: Tree Constraints Plan		
Date drawn: 17/12/2025		
Scale: 1:200 at A3		
Drawn by: NH	Checked by: PD	



Appendix 2: Tree Survey Schedule

Site: 40 Mytten Close

Survey date: 16th December 2025

Surveyor: N.Hollett


Tree Survey Schedule



Tree ref.	Species	Height (m)	Stem diameter (mm)	Branch spread (m)	Crown clearance (m)	Age class	Physiological condition	Structural condition	Comments	Preliminary management recommendation	Category grading	Root Protection Area (m ²)	Root Protection Radius (m)
T1	Yew (Taxus baccata)	7	330	N: 3 E: 3 S: 3 W: 3	Crown: 2 average Branch: 2 average	Semi mature	Good	Fair	Dual stemmed from 1.5m with included union with some reaction growth wood and minor exudation. Crossing/grafted branches. Previously crown lifted. Located in raised planter.	No action required on date of survey.	C1+2	49.3	4.0
T2	Turkey oak (Quercus cerris)	10	350	N: 4 E: 5 S: 4 W: 4	Crown: 3 average Branch: 2 east	Semi mature	Good	Fair	Historically crown lifted. Previously reduced for lamp column resulting in poor form and growth points. Historic crown damage at 4m.	No action required on date of survey.	B1+2	55.4	4.2
T3	Pedunculate oak (Quercus robur)	21	850 est	N: 8 E: 11 S: 10 W: 10	Crown: 6 average Branch: 8 average	Mature	Good	Good	Third party tree. Viewed from site and alleyway. No direct access and restricted view of tree. Primary structure at 8m. Previously crown lifted. Over extended limb east at 8m. Some historic crown damage and pruning wounds visible.	No action required on date of survey.	A1+2	326.9	10.2
G4	Portuguese laurel (Prunus lusitanica)	4-5 average	150 average	1-5 average	0 average	Mature	Good	Good	Large boundary group. Maintained laterally and in height. Some deadwood and minor decay at old pruning points. Provides screening to site.	No action required on date of survey.	C2	10.2 average	1.8 average
T5	Monterey cypress (Hesperocyparis macrocarpa)	3	850, 300, 250	N: 1 E: 2 S: 3 W: 0	Crown: 0 average Branch: 0 average	Mature	Fair	Fair	Previous large tree now reduced to 2m in height resulting in 2m stump. Only small lateral branches remain. The root protection has been adjusted to better align with the current condition of the heavily reduced tree.	No action required on date of survey.	C1+2	Refer to tree constraints plan.	Refer to tree constraints plan.
G6	Mixed (cherry laurel, Portuguese laurel)	2-4 average	150 average	1-2 average	0 average	Semi mature	Good	Good	Located around garage. Previously topped at 4m. Minor deadwood. Some lateral pruning.	No action required on date of survey.	C2	10.2 average	1.8 average

Site: 40 Mytten Close
Survey date: 16th December 2025
Surveyor: N.Hollett

Tree Survey Schedule

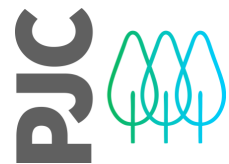

Tree ref.	Species	Height (m)	Stem diameter (mm)	Branch spread (m)	Crown clearance (m)	Age class	Physiological condition	Structural condition	Comments	Preliminary management recommendation	Category grading	Root Protection Area (m ²)	Root Protection Radius (m)
G7	Mixed (laurel, firethorn)	2-4 average	100 average	1-2 average	0 average	Semi mature	Good	Good	Mixed boarder group. Some areas trained up wall.	No action required on date of survey.	C2	4.3 average	1.2 average

Appendix 3: Cascade Chart for Tree Quality Assessment

Category and definition	Criteria (including subcategories where appropriate)			Identification on plan
Trees unsuitable for retention				
Category U Those in such a condition that they cannot realistically be retained as living trees in the context of their current land use for longer than 10 years.	• Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after the removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning). • Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline. • Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality. Note Category U trees can have existing or potential conservation value which it might be desirable to preserve.			Red
	1 Mainly arboricultural qualities	2 Mainly landscape qualities	3 Mainly cultural values, including conservation	
Trees to be considered for retention				
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years.	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue).	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features.	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood--pasture).	Green
Category B Trees of moderate quality with an estimated remaining life expectancy of at least 20 years.	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remedial defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation.	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality.	Trees with material conservation or other cultural value.	Blue
Category C Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm.	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories.	Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape benefits.	Trees with no material conservation or other cultural value.	Grey



CONTACT DETAILS

Sussex Office:

Rocks Yard
Victoria Road
Herstmonceux
Hailsham
East Sussex
BN27 4TQ

Tel: 01323 832120

Kent Office:

The Watermill
The Mill Business Park
Maidstone Road
Ashford
Kent
TN26 1AE

Tel: 01233 225365

Author: N.Hollett

Date: 17th December 2025

E-mail: n.hollett@pjconsultancy.com